

AD-A031 951

AFFDL-TR-76-36  
VOLUME II

**DEVELOPMENT OF RELIABILITY-BASED AIRCRAFT SAFETY  
CRITERIA: AN IMPACT ANALYSIS  
VOLUME II: COMPUTER MANUAL**

*MODERN ANALYSIS INC.  
RIDGEWOOD, NEW JERSEY*

APRIL 1976

TECHNICAL REPORT, AFFDL-TR-76-36, VOLUME II  
FINAL REPORT FOR PERIOD APRIL 1975 - APRIL 1976

Approved for public release; distribution unlimited

**Best Available Copy**

AIR FORCE FLIGHT DYNAMICS LABORATORY  
AIR FORCE WRIGHT AERONAUTICAL LABORATORIES  
AIR FORCE SYSTEMS COMMAND  
WRIGHT-PATTERSON AIR FORCE BASE, OHIO 45433

20060921167

NOTICE

When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data, is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

This report has been reviewed by the Information Office (OI) and is releasable to the National Technical Information Service (NTIS). At NTIS, it will be available to the general public, including foreign nations.

This technical report has been reviewed and is approved for publication.

*Robert L. Neulieb*

ROBERT L. NEULIEB  
Project Engineer

*R.M. Bader*

ROBERT M. BADER, Chief  
Structural Integrity Br  
Structures Division

FOR THE COMMANDER

*Howard L. Farmer*

HOWARD L. FARMER, Colonel, USAF  
Chief, Structural Mechanics Division

Copies of this report should not be returned unless return is required by security considerations, contractual obligations, or notice on a specific document.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER AFFDL-TR-76-36, Volume II	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle)  DEVELOPMENT OF RELIABILITY-BASED AIRCRAFT SAFETY CRITERIA: AN IMPACT ANALYSIS		5. TYPE OF REPORT & PERIOD COVERED Final Report April, '75-April, '76
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s)  Masanobu Shinozuka	8. CONTRACT OR GRANT NUMBER(s)  F33615-75-C-3066	
9. PERFORMING ORGANIZATION NAME AND ADDRESS Modern Analysis Inc. 229 Oak Street Ridgewood, N.J. 07450	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS  13670123	
11. CONTROLLING OFFICE NAME AND ADDRESS Air Force Flight Dynamics Laboratory Air Force Systems Command Wright-Patterson Air Force Base, Ohio 45433	12. REPORT DATE April 1976	
	13. NUMBER OF PAGES 33 80	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	15. SECURITY CLASS. (of this report) Unclassified	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report)  Approved for public release; distribution unlimited		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  Safety, Reliability, Durability, Damage Tolerant Design, Fail Safe Design, Random Loading, Rise and Fall of Random Processes, Crack Propagation, Fracture Mechanics, Proof Load Testing, Full-Scale Testing, Inspections, NDI Techniques.		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number)  The random stress processes, composite Gaussian or single Gaussian are constructed on the basis of exceedance curves for different aircraft under various flight conditions. The fatigue crack propagations under such stress processes are estimated with the aid of fracture mechanics method. The crack propagation rate under random loading is assumed to be proportional to the expected value of a power of the range of stress intensity factor which is in turn		

## UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

proportional to the expected value of the same power of the rise and fall of the stress process involved. The residual strength is evaluated as a function of crack size either under the assumption of slow crack growth design or under the assumption of fail safe design. Two different models as to the basic mechanical nature of the crack are used for the analysis and their interrelationships are discussed. One of these is the crack initiation model in which a crack of certain size is assumed to initiate at "randomly distributed time"  $t_0$  and then propagate in accordance with the propagation law of fracture mechanics. The other is the pre-existing crack model which assumes pre-existence of cracks of random size. With the aid of the random process theory, the failure rate is evaluated as the expected rate of upcrossing of the residual strength by the stress process. The probability of aircraft failure is obtained from the failure rate taking into consideration the effect of inspection procedures and proof loads. The latter, however, is considered only in conjunction with pre-existing crack model. The significance of full-scale testing is also reviewed from the view point of reliability implementation and demonstration. Numerical examples are worked out to illustrate the numerical significance of various analytical models and to indicate the sensitivity of the probability of failure to the parameters involved in the models. This volume contains computer program lists, input and output descriptions, input and output samples, flow charts and other data necessary for numerical work associated with the tasks described above.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

## FOREWORD

This users manual report was prepared by Modern Analysis Inc., Ridgewood, N.J., under Air Force Contract No. F33615-75-C-3066. The work was monitored by the Air Force Flight Dynamics Laboratory, FBE, Air Force Systems Command, United States Air Force, Wright-Patterson Air Force Base, Ohio, project 1367, task number 01, with Dr. Robert L. Neulieb (AFFDL/FBE) as Project Engineer.

The project was conducted under the general direction of Dr. M. Shinozuka, President, Modern Analysis Inc.

Dr. R. Vaicaitis and Mr. P. Wai, provided the programming and documentation efforts. The programs documented herein are written for operation on a CDC6600 computer system.

The work reported herein was performed during the period April 1975 to March 1976. The final report in two volumes was submitted on April 30, 1976.

## TABLE OF CONTENTS

SECTION	PAGE
1 INTRODUCTION	1
2 MANEUVER LOADING PROGRAM (MANLOD)	2
2.1 SIMULATION AND RANGE COUNT	2
2.2 INPUT DATA	5
2.3 PROGRAM DESCRIPTION	6
2.3.1 The Main Program Unit MANLOD	6
2.3.2 Subroutine AREA	7
2.3.3 Subroutine SIMULT	7
2.3.4 Subroutine MARM	8
2.3.5 Subroutine PLOT	8
2.3.6 Subroutine PICK	8
2.3.7 Subroutine STDEVI	9
2.3.8 Subroutine MEAN7	9
2.3.9 Subroutine PICKM	9
2.3.10 Subroutine PICKMX	9
2.3.11 Subroutine CROSS	10
2.3.12 Subroutine SIMPSN	10
2.3.13 Subroutine RANDU	10
2.3.14 Subroutine FUNSPT	11
2.3.15 Subroutine STATIS	11
2.4 PROGRAM OUTPUT	11
3 AIRCRAFT RELIABILITY WHEN TIME TO CRACK INITIATION IS A RANDOM VARIABLE (ARELL)	16
3.1 INPUT DATA	18
3.2 PROGRAM DESCRIPTION	20

TABLE OF CONTENTS (CONTINUED)

3.2.1	The Main Program Unit ARELL	20
3.2.2	Subroutine HCOM	22
3.2.3	Subroutine HSIN	22
3.2.4	Subroutine QSF	23
3.2.5	Function EEXP	23
3.2.6	Function F	23
3.2.7	Function FS	23
3.2.8	Function ERF	24
4	AIRCRAFT RELIABILITY WHEN INITIAL CRACK SIZE IS A RANDOM VARIABLE (AREL2)	29
4.1	INPUT DATA	30
4.2	PROGRAM DESCRIPTION	30
4.2.1	The Main Program Unit AREL2	30
4.2.2	Subroutine DENST	32
4.2.3	Subroutine HCOM	33
4.2.4	Subroutine HSIN	33
4.2.5	Subroutine QSF	33
4.2.6	Subroutine CIN	33
4.2.7	Subroutine HIN	33
4.2.8	Function ERF	34
4.2.9	Function OMEXP	34
4.2.10	Function FF	34
4.2.11	Function FC	34
4.3	PROGRAM OUTPUT	34
APPENDIX A	MANLOD SIMULATION PROGRAM	36
APPENDIX B	AREL1 PROGRAM	57
APPENDIX C	AREL2 PROGRAM	67

## LIST OF ILLUSTRATIONA

FIGURE		PAGE
1	Simplified Flow Chart of MANLOD Program	3
2	Simplified Flow Chart of the ARELL Program	17
3	Simplified Flow Chart of the AREL2 Program	31

LIST OF TABLES

TABLE		PAGE
1	Rise and Fall (First Counting Method)	12
2	Rise and Fall (Second Counting Method)	13
3	Average of Power of Rise and Fall (First Counting Method)	14
4	Average of Power of Rise and Fall (Second Counting Method)	14
5	Threshold Crossing	15
6	Crack Size A, Residual Strength R, Failure Rate H, Summation of Failure Rate TH, Time to Crack Initiation W	26
7	Probability of First Aircraft Failure (No Inspection)	27
8	Probability of First Aircraft Failure (Inspections Included)	28
9	Crack Size A, Failure Rate H, Probability of Failure for Single Airplane PA, Probability of Failure in a Fleet TPA (Fail-Safe)	35
10	Crack Size A, Failure Rate H, Probability of Failure for Single Airplane PA, Probability of Failure in a Fleet TPA (Slow Crack Growth)	35

## SECTION 1

### INTRODUCTION

The probabilities of first aircraft failure under a prescribed mission loading and a number of rigorous and cursory inspections are calculated analytically. Three programs were written for this purpose. The first program, called Maneuver Loading (MANLOD), calculates the average of rise and fall of the stress process due to aircraft maneuvers or gust utilizing a simulation technique of random processes. The results from this program serve as an input to the other two programs. The second program, called Aircraft Reliability when Time to Crack Initiation is a Random Variable (AREL1), evaluates probabilities of first aircraft failure based on the condition that time to fatigue crack initiation is distributed according to a two-parameter Weibull distribution. The third program, called Aircraft Reliability when Initial Cracks are Random Variables (AREL2), calculates probabilities of first aircraft failure based on the initial crack size distribution model. The following sections of this document discuss these three programs, their options, the input data, and the output.

SECTION 2  
MANEUVER LOADING PROGRAM (MANLOD)

The purpose of MANLOD program is to determine the rise and fall of the stress response process due to aircraft maneuvers or atmospheric turbulence. The results from this program serve as an input to the aircraft reliability programs ARELL and AREL2 which are described in Sec. 3 and 4. A simplified flow chart of the MANLOD program is shown in Figure 1.

### 2.1 SIMULATION AND RANGE COUNT

The time history of stress response due to aircraft maneuvers or gust is generated from the specified stress spectral densities utilizing simulation techniques of Gaussian random processes. For the purpose of this study, the stress history due to gust is generated from a specified normalized spectral density function corresponding to a truncated Gaussian white noise spectra. The area under this spectral density is unity. The width of this spectra is controlled by a parameter called BETA which ranges  $0.0 \leq BETA < 1$ . For example,  $BETA = 0$  corresponds to a wide band process and  $BETA = 0.9$  to a narrow band process. The stress time history due to aircraft maneuvers is generated from the specified spectral density in Function FUNSPT. If the spectral density due to maneuvers is specified in terms of accelerations  $g^2$ , the conversion to stress spectral density is achieved through the parameter  $g$ . To account for the unsymmetric exceedance observed in actual maneuver exceedance


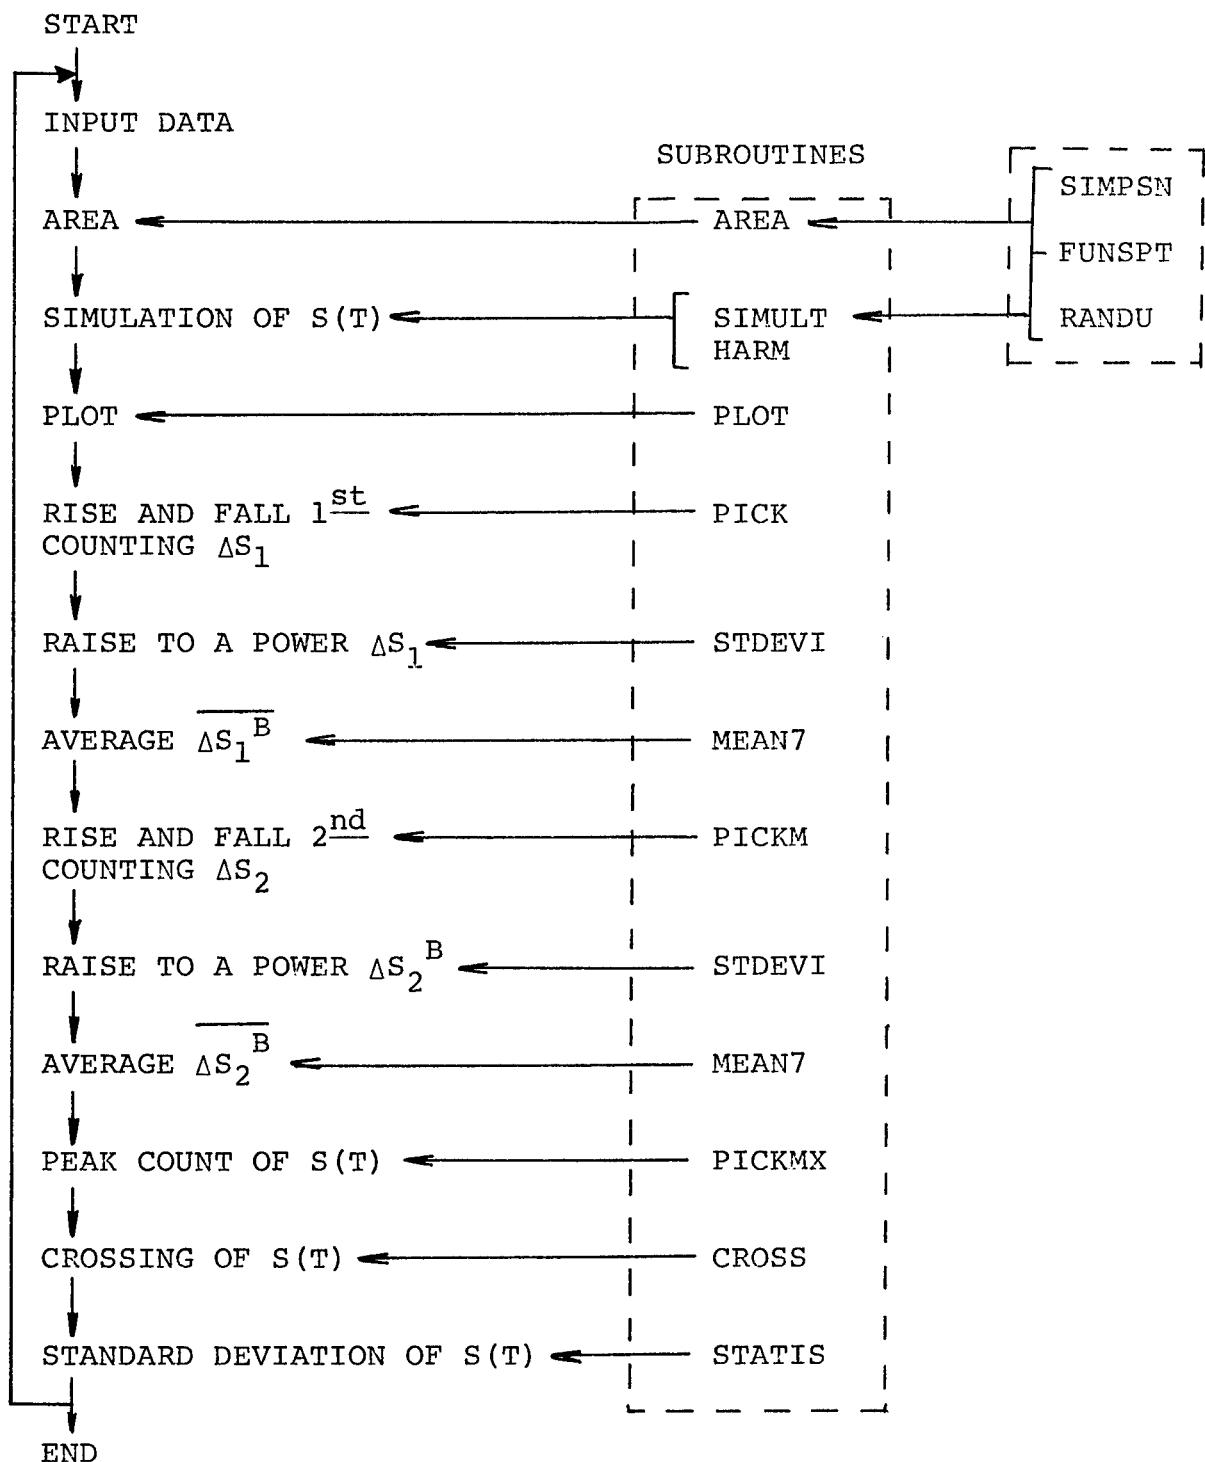



Figure 1. Simplified Flow Chart of MANLOD Program

curves, the stress time history is modified by multiplying the negative portion by a factor called REDUCE = standard deviation for negative maneuvers/standard deviation for positive maneuvers.

The rise and fall,  $\Delta S_i$ , of the simulated process  $S_m(t)$  are determined using two separate range count methods. In the first method, the  $\Delta S_{1,i}$  values are determined by selecting the difference

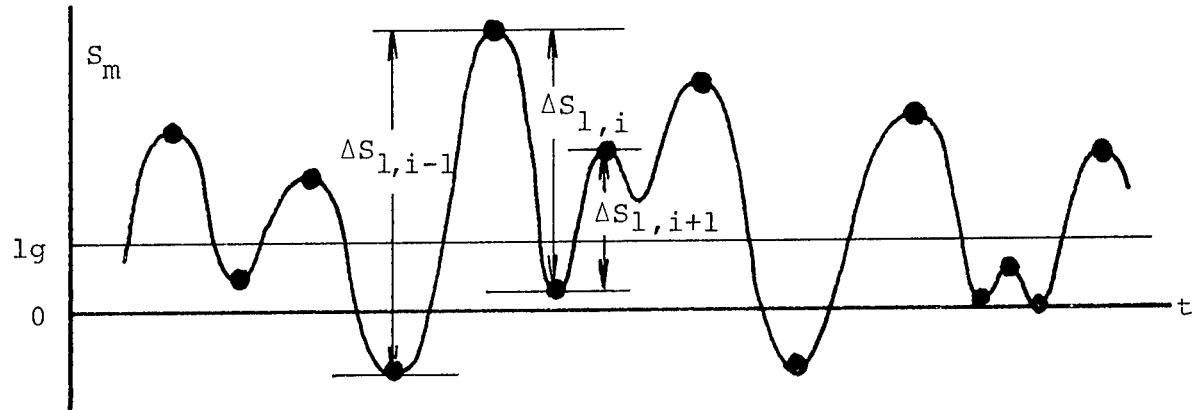

between the consecutive peak and valley as shown above. In the second counting method, the  $\Delta S_{2,i}$  values are selected from the difference between those peaks and valleys which are separated by the lg line as shown below.

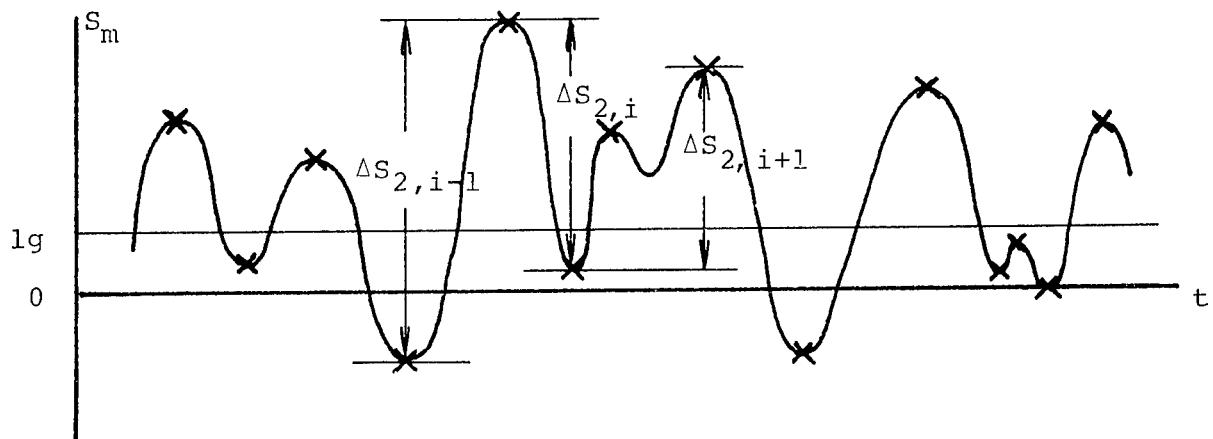

## 2.2 INPUT DATA

There are no input data cards used for the Maneuver Loading Program. The necessary data parameters need to be specified at the beginning of the main program. The input spectral density function of the maneuver loading in  $g^2$  units need to be specified. An option is provided to use a normalized truncated white noise spectrum. The input parameters are as follow: maneuver loading spectral density function SS(W) with parameters A, FB and PHIO where A = a shape parameter; FB = break frequency in Hz; PHIO = peak value of the spectral density function SS(W); IX = an odd integer with less than 9 digits where by changing IX a new sample function is generated; N = number of frequency subdivisions on the spectral density function SS(W) in powers of 2; NPT = a number of simulated points of the output sample function specified by NPT =  $2^{**} M_1$  with  $2 * N$  being equal to or less than NPT, WU = the upper cut-off frequency on SS(W); WL = the lower cut-off frequency on SS(W); M1 = a positive integer such that NPT =  $2^{**} M_1$ , NSIGN = an option parameter where for NSIGN = 0 a normalized white noise spectral density with a unit standard deviation is provided by the program, and for NSIGN = 1 the user must supply a spectral density for the maneuver loading or use the one specified in the subroutine FUNSPT; REDUCE = ratio of the standard deviations such that REDUCE =  $\sigma_n / \sigma_p$  where  $\sigma_n$  is the standard deviation determined from the time history below the lg level and  $\sigma_p$  is the standard deviation obtained from the time history above the lg level; NP = number of points plotted by the subroutine PLOT; BETA = parameter which specifies the width of the truncated Gaussian white noise spec-

trum; NSAMPL = number of samples to be simulated.

## 2.3 PROGRAM DESCRIPTION

The Maneuver Loading Program consists of a main program unit and fourteen subroutines. The program listing is given in Appendix A. The main program unit called MANLOD and the fourteen subroutines: AREA, SIMULT, PLOT, PICK, STDEVI, MEAN7, PICKM, PICKMX, CROSS, SIMPSN, FUNSPT, HARM, RANDU, STATIS are described as follows.

### 2.3.1 The Main Program Unit MANLOD

The main program initializes the input data and with a call to the subroutine AREA calculates the area under the maneuver loading spectral density specified in Function FUNSPT. The time realizations of the loading (or stress) are generated by calling subroutine SIMULT. When NSIGN = 0, stress time history corresponding to gust input is provided. When NSIGN = 1, stress time history due to maneuvers is given. The rise and fall of the simulated time history are determined by calling subroutine PICK for the first counting method and subroutine PICKM for the second counting method. The rise and fall values are raised to an arbitrary power B ranging from 1 to 10 by subroutine STDEVI. Then, the average of rise and fall raised to B power is calculated by calling subroutine MEAN7. The total number of peaks of the simulated process  $S_m(t)$  is counted by the subroutine PICKMX and the crossing rate is determined from subroutine CROSS. A subroutine PLOT is called to plot the output time history for one realization.

### 2.3.2 Subroutine AREA (S, N, WUP, WL)

Subroutine AREA calculates the area under the curve specified in FUNSPT. It utilizes a Simpson rule type integration procedure given in Function SIMPSN. The arguments for this subroutine are

S = input data from FUNSPT;

N = number of subdivisions on spectral density SS;

WUP = upper cut-off frequency on SS;

WL = lower cut-off frequency on SS.

### 2.3.3 Subroutine SIMULT (A, N, NPT, WU, WL,

### IX, M1, NSIGN, INV, S)

The subroutine SIMULT is used to generate samples of the time history corresponding to gust or maneuver loading. The program utilizes the Fast Fourier Transform (FFT) algorithm by calling subroutine HARM. The essential equations for this simulation are

Real    A(2 \* J + 1) = SQRT(2.0 \* SP) \* COS(PHI)

Imaginary    A(2 \* J + 2) = SQRT(2.0 \* SP) \* SIN(PHI)

where J = 1, 2, . . . , N, SP = specified spectral density,

PHI = random phase angles uniformly distributed between 0 and  $2\pi$  which are generated by subroutine RANDU. The arguments for this subroutine are A = specified by the above equations; N = number of subdivisions on spectral density SP; NPT = number of time points to be simulated; WU = upper cut-off frequency on SP; WL = lower cut-off frequency on SP; IX = a number specified in the input; NSIGN = specified in the input; INV, S = internal parameters of the subroutine.

#### 2.3.4 Subroutine HARM (A, M, INV, S, IFSET, IFERR)

Subroutine HARM perform a Fast Fourier Transform (FFT) on the specified function  $A(I)$ , ( $I = 1, 2, \dots, N$ ). The arguments for this subroutine are

$A$  = generated input by the subroutine SIMULT;

$M$  = number of points to be simulated, i.e., for one dimensional case  $M(1) = M_1$ ,  $M(2) = 0$ ,  $M(3) = 0$ .

$INV, S$  = internal parameters of the subroutine;

$IFSET = 1$ , implies a forward Fourier Transform,  $IFSET = -1$  implies an inverse Fourier Transform;

$IFERR$  = internal parameter of the subroutine.

#### 2.3.5 Subroutine PLOT (NP, DT, A, 0.0, M)

Subroutine PLOT plots a given function  $A$  with a dimension  $NP$  at step intervals  $DT$ . The argument  $M$  indicates how many points from given  $NP$  needs to be plotted. For example, if  $M = 1$ , it implies that every point is plotted, if  $M = 2$ , it implies that every second point is plotted.

#### 2.3.6 Subroutine PICK (A, NPT, S, NPK(J))

Subroutine PICK determines the rise and fall  $\Delta S_{li}$  corresponding to the first counting procedure as described in Sec.

2.1. The arguments for PICK program are

$A$  = input array from which rise and fall needs to be found;

$NPT$  = number of points in the input array  $A$ ;

$S$  = an array in which the rise and fall are stored;

$NPK$  = number of rise and fall values found from the specified input  $A$ .

2.3.7 Subroutine STDEVI (NST, NPK(J), S, STD,  
RMS, A1(J), A2(J), . . . , A5(J), AN)

This subroutine raises the rise and fall values calculated in PICK to powers A1, A2, . . . , A5, where

NST = parameter calculated by the main program;

NPK = number of rise and fall values;

S = rise and fall;

STD, RMS, AN = parameters calculated inside the subroutine.

2.3.8 Subroutine MEAN7 (NSAMPL, A1, . . . , A5,  
A1, . . . , AM5, AA, AN)

Subroutine MEAN7 calculates the average of rise and fall raised to arbitrary power in subroutine STDEVI.

NSAMPL = sample size for which average is calculated;

A1, . . . , A5 = parameters obtained in subroutine STDEVI;

A1, . . . , AM5 = calculated in the subroutine;

AA = calculated in the main program;

AN = calculated in the subroutine

2.3.9 Subroutine PICKM (A, NPT, S, MPK(J))

This subroutine calculates the rise and fall  $\Delta S_{2i}$  corresponding to the second counting procedure as described in Sec. 2.1.

The meaning of the arguments is the same as for subroutine PICK.

2.3.10 Subroutine PICKMX (Y, NPT, PMAX, LPACK,  
PMIN, MTROG)

Subroutine PICKMX picks all the peaks and troughs from a given process.

NPT = number of points;

Y = input process;

PMAX = array for peak values;  
PMIN = array for trough values;  
LPEAK = number of peaks found;  
MTROG = troughs found.

2.3.11 Subroutine CROSS (STDEV, PMAX,  
PMIN, LLL, MMM, VZERO, RATIO)

This subroutine determines the crossing of the threshold level specified by STDEV for a given process.

STDEV = standard deviation of the given process.

PMAX = peak value array of the process;

PMIN = trough value array of the process;

LLL = number of peaks;

MMM = number of troughs;

VZERO = indicates zero threshold crossing;

RATIO = when RATIO = 1, crossing for the total given time history is determined, when RATIO = 0, crossing per hour is found.

2.3.12 Subroutine SIMPSN (AF, NPT,  
DSTEP, SIMP)

Subroutine SIMPSN integrates a given function AF utilizing a Simpson rule integration procedure.

NPT = number of points to be integrated (must be an odd number)

DSTEP = integration step;

SIMP = resulting area of integration.

2.3.13 Subroutine RANDU (IX, IY, YFL)

Subroutine RANDU generates independent random numbers

uniformly distributed between 0 and 1. By multiplying these numbers by  $2\pi$ , random phase angles, which are necessary for the digital simulation procedure, are obtained. An odd integer, IX, needs to be specified in the main program. By changing IX, a new seed of random numbers is generated.

IX = any odd integer less than 9 digits;  
IY = internal parameter in the program;  
YFL = output - random numbers between 0 and 1.

#### 2.3.14 Subroutine FUNSPT (SP, W1)

Subroutine FUNSPT is used to array the normalized empirical spectral density function corresponding to aircraft maneuvers.

$$SS(W) = 2\pi * \text{PHIO} / (1 + (2\pi * W/\text{FB}) ^{\star\star} A) / \text{ANORML}$$

where

W = frequency in HZ;  
FB, A, PHIO = data parameters;  
ANORML = area under SS which is determined in subroutine  
AREA.

#### 2.3.15 Subroutine STATIS (A, NP, STD, RMS)

Subroutine STATIS determines the standard deviation and rms of maneuver loading.

A = input array;  
NP = number of points;  
STD = output - standard deviation;  
RMS = output - root mean square.

### 2.4 PROGRAM OUTPUT

The MANLOD program generates printed output. In Table 1, the average of rise and fall for one realization is given using the first range counting method described in Sec. 2.1.

TABLE 1. RISE AND FALL  
(FIRST COUNTING METHOD)

BETA= 0.0 NPEAK= 2285 WJ= 0.2000 WL= 0.0070  
MEAN1= 0.692 MEAN2= 0.902 MEAN3= 1.547 MEAN5= 2.163 MEAN4= 3.129  
MEAN6= 0.17803E 02 MEAN7= 0.48034E 02 MEAN8= 0.13826E 03 MEAN9= 0.42070E 03  
MEAN45= 4.661 MEAN5= 7.126  
MEAN10= 0.13425E 04

STDEV= 0.6505576E 00 RMS= 0.9499773E 00

NPEAK = number of rise and fall;

WU = upper cut-off frequency on spectral density;

WL = lower cut-off frequency on spectral density;

STDEV = standard deviation of the rise and fall;

RMS = root mean square of the rise and fall;

MEAN1, MEAN2. . . . , MEAN10 = indicates the mean values if rise  
and fall which were raised to powers 1, 2, . . . , 10,  
respectively.

Similar results are shown in Table 2 for the second range counting method. The standard deviation and rms of  $S_m(t)$  are also included in this table.

TABLE 2. RISE AND FALL  
(SECOND COUNTING METHOD)

BETA= 0.0	NPEAK= 1000	WJ= 0.2000	WL= 0.0070
MEAN1= 1.292	MEAN2= 2.274	MEAN3= 4.791	MEAN35= 7.295
MEAN5= 0.84493E 02	MEAN7= 0.25793E 03	MEAN8= 0.83775E 03	
STDEV= 0.7776743E 00			RMS= 0.1508034E 01
MEAN4= 11.401	MEAN45= 18.237	MEAN5= 29.802	
MEAN9= 0.29053E 04	MEAN10= 0.10559E 05		

STANDARD DEVIATION OF THE TIME HISTORY

STDEV= 0.6485804E 00      R.M.S.= 0.7130958E 00

The average of rise and fall corresponding to averaged eight realizations is given in Table 3 for the first range counting method and in Table 4 for the second range counting method. The number of rise and fall for each method is also indicated in these tables.

TABLE 3. AVERAGE OF POWER OF RISE AND FALL  
(FIRST COUNTING METHOD)

CASE I

AVERAGE OF POWER OF RISE AND FALL  
AND NUMBER OF RISE AND FALL

BETA	POWER							RISE & FALL
	1.0	2.0	3.0	3.5	4.0	4.5	5.0	
0.0	0.696	0.933	1.670	2.397	3.568	5.479	8.645	2269
BETA	6.0	7.0	8.0	9.0	10.			PEAKS
0.0	23.05	56.38	203.68	659.41	2235.61			2269

TABLE 4. AVERAGE OF POWER OF RISE AND FALL  
(SECOND COUNTING METHOD)

CASE II

AVERAGE OF POWER OF RISE AND FALL  
AND NUMBER OF RISE AND FALL

BETA	POWER							RISE & FALL
	1.0	2.0	3.0	3.5	4.0	4.5	5.0	
0.0	1.276	2.254	4.371	7.512	11.932	19.395	32.211	1031
BETA	6.0	7.0	8.0	9.0	10.			PEAKS
0.0	94.00	222.95	956.31	3350.72	12147.27			1031

The level of threshold crossing per hour against standard deviations of the process is given in Table 5.

TABLE 5. THRESHOLD CROSSING

NUMBER OF TOTAL CROSSINGS AT DIFFERENT LEVEL OF SIGMA,  
INCLUDES CROSSINGS WITH BOTH +VE AND -VE SLOP

## SIMULATED RESULT

-5.0SIGMA=	0	CROSSINGS
-4.8SIGMA=	0	CROSSINGS
-4.5SIGMA=	0	CROSSINGS
-4.4SIGMA=	0	CROSSINGS
-4.2SIGMA=	0	CROSSINGS
-4.0SIGMA=	0	CROSSINGS
-3.8SIGMA=	0	CROSSINGS
-3.5SIGMA=	0	CROSSINGS
-3.4SIGMA=	0	CROSSINGS
-3.2SIGMA=	0	CROSSINGS
-3.0SIGMA=	0	CROSSINGS
-2.8SIGMA=	0	CROSSINGS
-2.6SIGMA=	0	CROSSINGS
-2.4SIGMA=	0	CROSSINGS
-2.2SIGMA=	0	CROSSINGS
-2.0SIGMA=	0	CROSSINGS
-1.8SIGMA=	0	CROSSINGS
-1.6SIGMA=	0	CROSSINGS
-1.4SIGMA=	0	CROSSINGS
-1.2SIGMA=	0	CROSSINGS
-1.0SIGMA=	0	CROSSINGS
-0.8SIGMA=	4	CROSSINGS
-0.6SIGMA=	25	CROSSINGS
-0.4SIGMA=	84	CROSSINGS
-0.2SIGMA=	188	CROSSINGS
0.0SIGMA=	350	CROSSINGS
0.2SIGMA=	308	CROSSINGS
0.4SIGMA=	267	CROSSINGS
0.6SIGMA=	229	CROSSINGS
0.8SIGMA=	193	CROSSINGS
1.0SIGMA=	163	CROSSINGS
1.2SIGMA=	134	CROSSINGS
1.4SIGMA=	108	CROSSINGS
1.6SIGMA=	78	CROSSINGS
1.8SIGMA=	54	CROSSINGS
2.0SIGMA=	40	CROSSINGS
2.2SIGMA=	24	CROSSINGS
2.4SIGMA=	13	CROSSINGS
2.6SIGMA=	8	CROSSINGS
2.8SIGMA=	3	CROSSINGS
3.0SIGMA=	2	CROSSINGS
3.2SIGMA=	1	CROSSINGS
3.4SIGMA=	0	CROSSINGS
3.6SIGMA=	0	CROSSINGS
3.8SIGMA=	0	CROSSINGS
4.0SIGMA=	0	CROSSINGS
4.2SIGMA=	0	CROSSINGS
4.4SIGMA=	0	CROSSINGS
4.6SIGMA=	0	CROSSINGS
4.8SIGMA=	0	CROSSINGS
5.0SIGMA=	0	CROSSINGS

### Section 3

#### AIRCRAFT RELIABILITY WHEN TIME TO CRACK INITIATION IS A RANDOM VARIABLE (AREL1)

The purpose of this program is to calculate the probability of first aircraft failure either of a single airplane or of an airplane in a fleet. The analytical probability of failure model is constructed for the case when time to fatigue crack initiation at a critical location on the aircraft is a random variable having a Weibull type distribution. The analytical model allows the inclusion of rigorous base type inspections which are performed at equal time intervals over the design life of the aircraft. A simplified flow chart of the program is shown in Figure 2. The following paragraphs discuss the input data, the structure of the program, and the output. The section on the structure of the program includes only the key analytical expressions. For a detailed description of all the equations, the reader should consult the Technical Report.

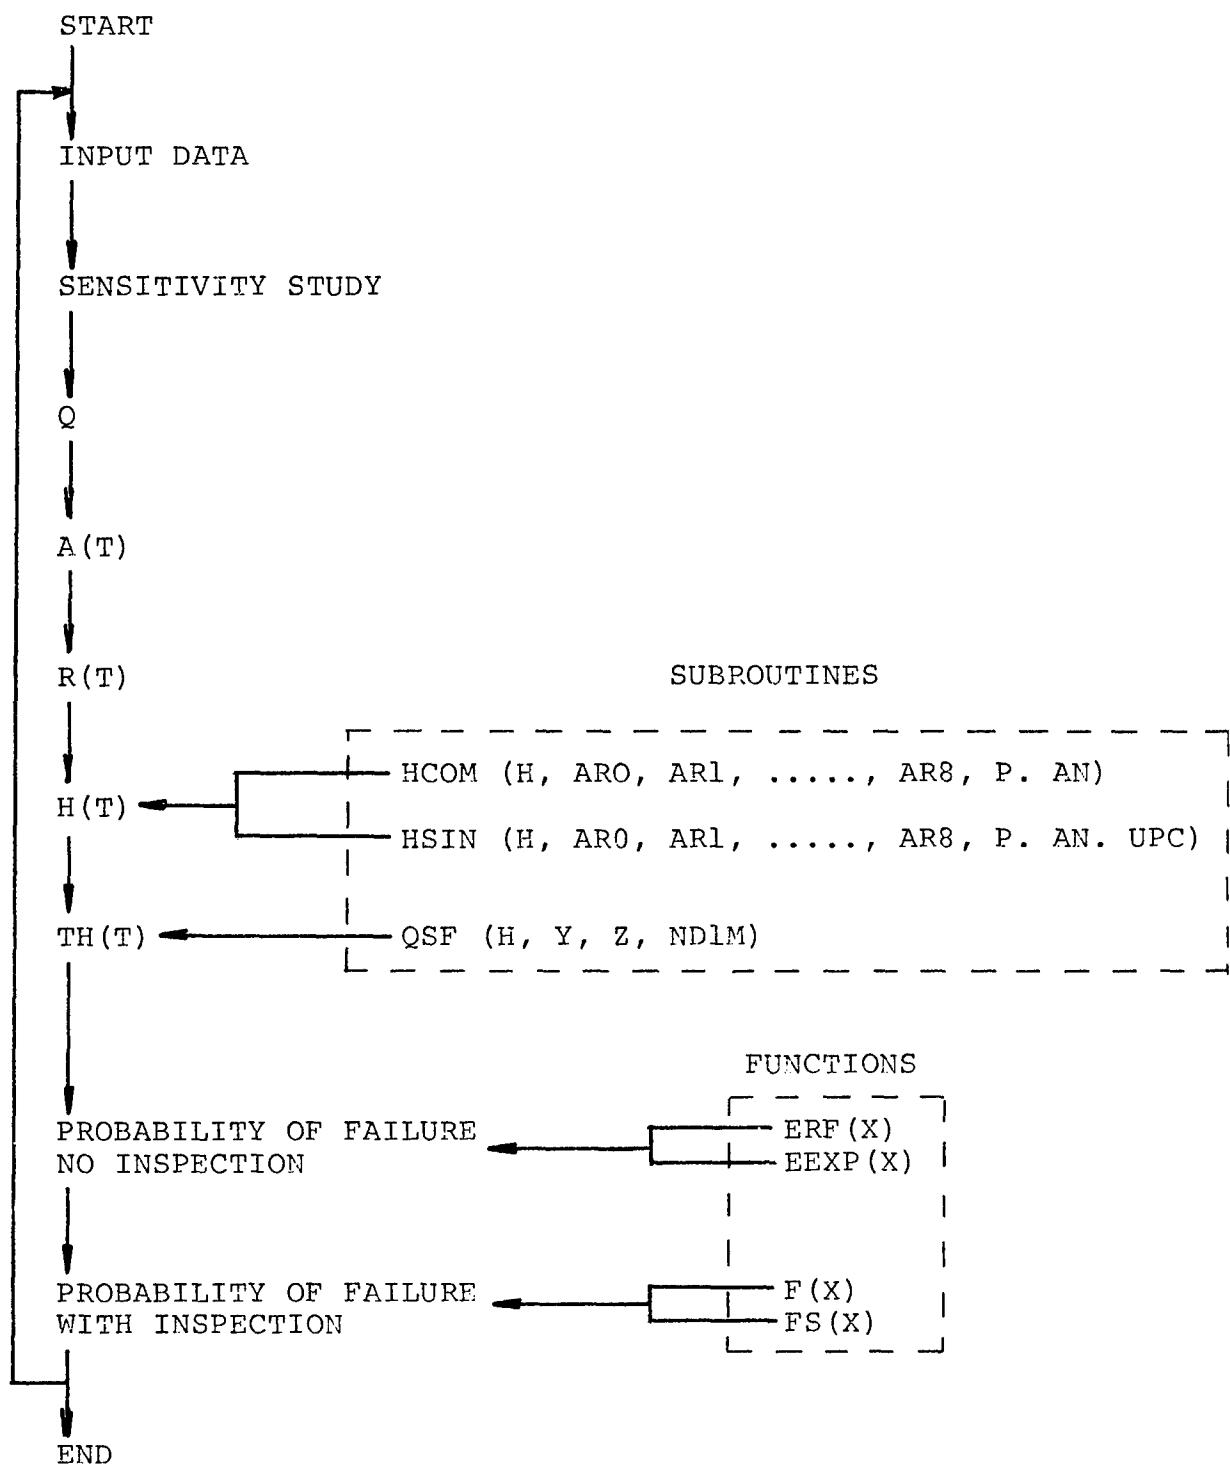


Figure 2. Simplified Flow Chart of the ARELL Program

### 3.1 INPUT DATA

There is one input data card used for the ARELL program. The Format of this data card is illustrated in Table 6.

TABLE 6.

#### DATA CARD FORMAT FOR ARELL PROGRAM

Column	Contents	Format
1-10	XY = a number from 1 to 32 which references the 32 parameters in the system	F 10.0
11-20	YZ1 = new input data if only one parameter is changed	F 10.0
21-30	YZ2 = new input data if two parameters are changed	F 10.0
31-40	YZ3 = new input data if three parameters are changed	F 10.0

The remaining data parameters are specified at the beginning of the main program. For the physical description of these parameters see the Technical Report.

The data are as follow: EF =  $\lambda$ , material constant; BE = b, a parameter in the fatigue crack propagation model; DKTH = threshold value of the range of stress intensity factor; EFD =  $\lambda'$ , material constant, C = c, material constant; KC = critical stress intensity factor; AO = initial fatigue crack

size; ALPHA = shape parameter in Weibull distribution; BETA = scale parameter in Weibull distribution; CMP(1) = 1., CMP(2) = 1., CMP(3) = 1. implies that the aircraft loads due to nonstorm turbulence, thunderstorms, and maneuvers each is taken as composite Gaussian processes; CMP(1) = 0.0, CMP(2) = 0.0, CMP(3) = 0.0 implies that the aircraft loads due to nonstorm turbulence, thunderstorms, and maneuvers each is taken as a single Gaussian process; UPC(1) = 1., UPC(2) = 1., UPC(3) = 1. implies that the input loads are truncated at certain level (single Gaussian case only); EL = the truncation index on maneuver loads; G = gravitational constant in ksi; AA(4), AAA(4) = rise and fall parameters of the random stress process due to gust which can be determined from MANLOD program by selecting the option NSIGN = 0; AAAA(4) = rise and fall parameter of the random stress process due to maneuvers which can be determined from MANLOD program by selecting the option NSIGN = 1; BAB(4) = (2 \* I - 1)!! where I = BE/2 and (2 \* I - 1)!! = 1 • 3 • 5 . . . ; AN(1), AN(2) = characteristic stress response frequencies corresponding to gust; AN(3) = characteristics stress response frequency corresponding to maneuvers; ANA = characteristic stress response frequency corresponding to ground - air - ground loads; PP(1), PP(2), PP(3) = fractions of aircraft flight time spent in clear air turbulence, thunderstorms, and maneuvers, respectively; SGC(1), SGC(2), SGC(3) = stress intensities due to clear air turbulence, thunderstorms, and maneuvers, respectively, when each loading is treated as a composite Gaussian process; SGS(1), SGS(2), SGS(3) = stress intensities due to

clear air turbulence, thunderstorms, and maneuvers, respectively, when each loading is treated as a single Gaussian process; XO = 1G level loading (level flight); ZR = stress intensity due to ground-air-ground loads; VO = coefficient of material strength variation; AMVO and RO = mean of the material strength; FSF = 1.0 indicates a fail-safe type design, FSF = 0.0 indicates a slow crack propagation model; ZETA = factor indicating the residual strength at the fail-safe crack size AS; AS = fail-safe crack size; TT = design service life of the airplane; A1 = minimum crack size below which the crack cannot be detected by inspection; A2 = maximum crack size beyond which the crack is always detected by inspection; RM = power exponent for the crack detection probability model; U = inspection probability; NN = number of rigorous base type inspections; NPT = number of divisions on Weibull distribution; NOI = number of output points when no inspections are included in the aircraft probability of failure model; NF = number of aircraft in a fleet. The units of the input data are time = hours, length = inches, strength = ksi; force = pounds.

### 3.2 PROGRAM DESCRIPTION

The Aircraft Reliability Program ARELL consists of a main program unit and seven subroutines HCOM, HSIN, QSF, ERF, EEXP, F and FS which are described in the following paragraphs. The program listing is given in Appendix B.

#### 3.2.1 The Main Program Unit ARELL

The main program reads and initializes the specified data as described in Sec. 3.1. The first part of the program

is designated for the sensitivity study of the 32 parameters in the aircraft reliability model. This is achieved by specifying the value of XY from 1 to 32. Each number of XY corresponds to a particular parameter in the system which are defined in Sec. 3.1.

The input load parameter, Q, due to the combined effect of the clear air turbulence, thunderstorms, maneuvers, and ground - air - ground loads is calculated from

$$A = AN(1) * PP(1) * SB(1) + AN(2) * PP(2) * SB(2) \\ + AN(3) * PP(3) * SB(3) + ANA * ZBB$$

where SB(1), SB(2), SB(3) and ZBB are the averages of the BE power of the rise and fall of the stress response process corresponding to clear air turbulence, thunderstorms, maneuvers, and ground - air - ground loads, respectively. These parameters are evaluated for a composite Gaussian process and for a single Gaussian process. The fatigue crack size at flight time T, A(I), (I = 1, 2, . . . , NPT) is determined utilizing the fail-safe design and the slow crack propagation models. The residual strength, R(I), is determined from the Griffith-Irwin equation

$$R(I) = FLOAT(KC) * SQRT(2.0/PI/A(I))/RO$$

for the slow crack propagation model and from

$$R(I) = 1.0 - (1.0 - ZETA) * SQRT((ABS(A(I)) \\ - AO)/(AS - AO)))$$

for the fail-safe design, where RO = ultimate strength. Then, the failure rate, H(I), is determined by calling subroutine HCOM when the input loading is treated as a composite Gaussian process and subroutine HSIN when the input loading is taken as a single Gaussian process. The summation of the failure rate from the

fatigue crack initiation to  $T$  flight hours after crack initiation is obtained by integrating the failure rate  $H(I)$  by calling subroutine QSF. The time to crack initiation having a two parameter Weibull distribution is calculated from

$$W(I) = \text{ALPHA}/\text{BETA} * \text{TBETA}^{**} \text{ALPH1}$$
$$* \text{EXP}(-\text{TBETA}^{**} \text{ALPHA})$$

where  $\text{TBETA} = T/\text{BETA}$ ,  $\text{ALPH1} = \text{ALPHA} - 1$ . Then, by specifying  $NN = 0$ , which implies no inspections, the probability of first aircraft failure,  $P(I)$ , is calculated. When  $NN \neq 0$  with the inspection probability  $F$  specified in FUNCTION F, the probability of first aircraft failure,  $P(J)$ , ( $J = TT/NN$ ) is determined at each inspection interval. The probability of first aircraft failure,  $TP(J)$ , in a fleet of  $NF$  airplanes is calculated from

$$TP(J) = 1.0 - (1.0 - P(J))^{**} NF$$

### 3.2.2 Subroutine HCOM (H, AR0, AR1, . . . , AR8, P, AN)

The subroutine HCOM determines the failure rate  $H(I)$  for the case when input loading is taken as a composite Gaussian process. The necessary arguments of the program are  
 $H$  = failure rate - output;  
 $AR0, AR1, . . . , AR8$  - calculated in the main program;  
 $P$  = input data corresponding to  $PP(1)$ ,  $PP(2)$  and  $PP(3)$ ;  
 $AN$  = characteristic frequency calculated in the main program.

### 3.2.3 Subroutine HSIN (H, AR0, AR1, . . . , AR8, P, AN, UPC)

The subroutine HSIN calculates the failure rate,  $H(I)$ , for the case when input loading is considered as a single Gaus-

sian process. The subroutine provides an option for truncating the failure rate at certain truncation level EL (for example maneuvers). This is achieved by setting UPC = 1.0 in the main program. The necessary arguments of the program are the same as in subroutine HCOM and UPC is specified as input data.

#### 3.2.4 Subroutine QSF (H, Y, Z, NDIM)

Subroutine QSF integrates the given input function Y at specified integration steps H and stores the results in Z at each integration step. NDIM = number of input points to be integrated.

#### 3.2.5 Function EEXP (ARG)

Function EEXP (ARG) is used to calculate EEXP (ARG) = EXP (ARG) - 1.0 by utilizing an expansion procedure for the case when ARG > -50.0 and  $0 \leq ARG \leq .01$ . When ARG < -50.0, EEXP (ARG) = -1.0, and when ARG > .01 no expansion is used.

#### 3.2.6 Function F(A)

Function F(A) specifies the crack detection probability corresponding to rigorous type inspections in terms of the crack size A. The necessary data for this function is specified in the main program.

#### 3.2.7 Function FS(A)

Function FS(A) determines probabilities of not detecting a fatigue crack.

#### 3.2.8 Function ERF

Function ERF calculates the error function in terms

of exponentials.

### 3.3 PROGRAM OUTPUT

The ARELL Program generates printed output. First the input data XY, YZ1, YZ2, YZ3 is printed as shown below for a particular example.

XY,YZ1,YZ2,YZ3 0.300000E 02 0.0 0.0 0.0

The calculated parameters SB1, SB2, SB3, ZBB, Q, ANS, ATH, TB, AC, TC, CDS, FSF are printed as shown below

SB1,SB2,SB3,ZBB,Q,ANS  
0.8283E 02( 1.0) 0.3622E 04( 1.0) 0.2400E 03( 1.0) 0.5063E 05

0.6267E 05 0.3300E 03

~~ATH,TB,AC,TC,CDS,FSF~~  
~~0.1039E 00 0.4247E 04 0.7054E 00 0.4827E 04 0.1434E-07 0.1000E 01~~

where

SB1, SB2, SB3, ZBB = average stress intensities raised to BE power corresponding to clear air turbulence, thunderstorms, maneuvers, and ground-air-ground loads, respectively.

Q = combined input loading;

ANS = PP(1) \* AN(1) + PP(2) \* AN(2) + PP(3) \* AN(3) is the average characteristic frequency of gust and maneuver loads combined;

ATH = fatigue crack size at the threshold level;

TB = time to reach threshold crack size;

AC = initial critical crack size;

TC = time to reach AC;

CDS = c ;calculated material constant in the crack propagation model

FSF = index denoting fail-safe or slow crack propagation model.

Table 6 contains a listing of the output sample for  
A, R, H, TH and W as functions of flight time T.

TABLE 6. CRACK SIZE A, RESIDUAL STRENGTH R, FAILURE RATE H,  
 SUMMATION OF FAILURE RATE TH, TIME TO CRACK INITI-  
 ATION W.

I	TIME	A	R	H	TH	W
1	0.0	0.0400	1.0000	1.330E-10	0.0	0.0
51	500.0	0.0412	0.9924	0.411E-10	0.191E-07	0.617E-09
101	1000.0	0.0427	0.9888	0.455E-10	0.407E-07	0.494E-08
151	1500.0	0.0445	0.9856	0.499E-10	0.646E-07	0.167E-07
201	2000.0	0.0467	0.9823	0.547E-10	0.907E-07	0.395E-07
251	2500.0	0.0496	0.9789	0.604E-10	0.119E-06	0.772E-07
301	3000.0	0.0536	0.9748	0.679E-10	0.151E-06	0.133E-06
351	3500.0	0.0603	0.9692	0.796E-10	0.188E-06	0.212E-06
401	4000.0	0.0755	0.9532	0.106E-09	0.233E-06	0.316E-06
451	4500.0	0.2145	0.9097	0.429E-09	0.331E-06	0.450E-06
501	5000.0	1.5828	0.7316	0.781E-07	0.501E-05	0.617E-06
551	5500.0	7.0000	0.4300	0.674E-03	0.187E-01	0.821E-06
601	6000.0	7.0000	0.4300	0.674E-03	0.523E-01	0.106E-05
651	6500.0	7.0000	0.4300	0.674E-03	0.860E-01	0.135E-05
701	7000.0	7.0000	0.4300	0.674E-03	0.120E-01	0.169E-05
751	7500.0	7.0000	0.4300	0.674E-03	0.153E-01	0.208E-05
801	8000.0	7.0000	0.4300	0.674E-03	0.187E-01	0.252E-05
851	8500.0	7.0000	0.4300	0.674E-03	0.221E-01	0.301E-05
901	9000.0	7.0000	0.4300	0.674E-03	0.254E-01	0.357E-05
951	9500.0	7.0000	0.4300	0.674E-03	0.288E-01	0.419E-05
1001	10000.0	7.0000	0.4300	0.674E-03	0.322E-01	0.488E-05
1051	10500.0	7.0000	0.4300	0.674E-03	0.355E-01	0.563E-05
1101	11000.0	7.0000	0.4300	0.674E-03	0.389E-01	0.646E-05
1151	11500.0	7.0000	0.4300	0.674E-03	0.423E-01	0.735E-05
1201	12000.0	7.0000	0.4300	0.674E-03	0.456E-01	0.832E-05
1251	12500.0	7.0000	0.4300	0.674E-03	0.490E-01	0.936E-05
1301	13000.0	7.0000	0.4300	0.674E-03	0.524E-01	0.105E-04
1351	13500.0	7.0000	0.4300	0.674E-03	0.557E-01	0.117E-04
1401	14000.0	7.0000	0.4300	0.674E-03	0.591E-01	0.129E-04
1451	14500.0	7.0000	0.4300	0.674E-03	0.625E-01	0.143E-04
1501	15000.0	7.0000	0.4300	0.674E-03	0.659E-01	0.157E-04
NN=	0					

In Table 7 the probabilities of first aircraft failure for a single airplane and in a fleet of 50 airplanes are shown for the case when no inspections are performed.

TABLE 7. PROBABILITY OF FIRST AIRCRAFT FAILURE (NO INSPECTIONS)

I, T, P(I), TP(I)	Single	Fleet
1 500.0	0.15522E-07	0.82608E-06
2 1000.0	0.33043E-07	0.16521F-05
3 1500.0	0.49586E-07	0.24793E-05
4 2000.0	0.66197E-07	0.33098F-05
5 2500.0	0.82990E-07	0.41495E-05
6 3000.0	0.99535E-07	0.49767F-05
7 3500.0	0.11640E-06	0.58200E-05
8 4000.0	0.13458E-06	0.67288F-05
9 4500.0	0.15530E-06	0.77649E-05
10 5000.0	0.17369E-06	0.86845E-05
11 5500.0	0.19418E-06	0.97090E-05
12 6000.0	0.25774E-06	0.12887F-04
13 6500.0	0.73039E-06	0.36519E-04
14 7000.0	0.27108E-05	0.13553E-03
15 7500.0	0.83435E-05	0.41709E-03
16 8000.0	0.21126F-04	0.10558E-02
17 8500.0	0.45866E-04	0.22907E-02
18 9000.0	0.89012E-04	0.44409E-02
19 9500.0	0.15871E-03	0.79041E-02
20 10000.0	0.26461E-03	0.13145E-01
21 10500.0	0.41823E-03	0.20699E-01
22 11000.0	0.63304E-03	0.31166E-01
23 11500.0	0.92381E-03	0.45161E-01
24 12000.0	0.13075E-02	0.63325E-01
25 12500.0	0.18027E-02	0.86270E-01
26 13000.0	0.24298E-02	0.11453E 00
27 13500.0	0.32106E-02	0.14853E 00
28 14000.0	0.41690E-02	0.18851E 00
29 14500.0	0.53304E-02	0.23450E 00
30 15000.0	0.67216E-02	0.28624E 00

The probabilities of first aircraft failure for a single airplane and a fleet of 50 airplanes with 5 scheduled inspections are given in Table 8.

TABLE 8. PROBABILITY OF FIRST AIRCRAFT FAILURE  
 (INSPECTIONS INCLUDED)

I, T, P(I), TP(I)	Single	Fleet
1 2500.0	0.82990E-07	0.41495E-05
2 5000.0	0.17184E-06	0.85919E-05
3 7500.0	0.72494E-06	0.36246E-04
4 10000.0	0.10433E-04	0.52150E-03
5 12500.0	0.53212E-04	0.26571E-02
6 15000.0	0.15889E-03	0.84099E-02

## SECTION 4

### AIRCRAFT RELIABILITY WHEN INITIAL CRACK SIZE IS A RANDOM VARIABLE (AREL2)

The purpose of AREL2 program is to determine the probability of first aircraft failure either of a single airplane or of an airplane in a fleet. The probability of aircraft failure is constructed on the condition that the initial fatigue crack size is a random variable for which the probability density function is obtained by appropriate transformation of the Weibull distribution of the time to fatigue crack initiation. The probability of failure model allows to include rigorous base type inspections which are performed at equal time intervals over the design life of the aircraft and cursory inspections which are performed at specified time intervals between the rigorous inspections. The probabilities of aircraft failure are calculated at rigorous inspections. The program includes options to study the effect of proof test and input load level truncation on the probability of first aircraft failure. A simplified flow chart of the program is shown in Figure 3. The following paragraphs discuss the input data, the structure of the program, and the output.

#### 4.1 INPUT DATA

There is one input data card which is of the same format as shown in Table 6 except the parameter XY now ranges from 1 to 34. The remaining data parameters are specified at the beginning of the main program. The main contents of the data parameters for AREL2 program is the same as for ARELL program. These are described in Sec. 3.1. The additional data parameters are as follow: NBN = number of subdivisions on the probability density function G(A0) corresponding to initial fatigue cracks; AL = lower limit of A0 for G(A0); AU = upper limit of A0 for G(A0); ACT = truncation level due to proof test on G(A0), CSRY = 0.0 implies no cursory inspections, CSRY = 1.0 implies cursory inspections included; NR = number of rigorous inspections; NC = number of cursory inspections; CAL = minimum crack size which is detected by cursory inspection.

#### 4.2 PROGRAM DESCRIPTION

The Aircraft Reliability Program AREL2 consists of a main program unit and eleven subroutines DENST, HCOM, HSIN, QSF, CIN, HIN, ERF, OMEXP, FF and FC which are described in the following paragraphs. The program listing is given in Appendix C.

##### 4.2.1 The Main Program Unit AREL2

The main program reads and initializes data as described in Sec. 4.1. The first part of the program is designated for the sensitivity study of the 34 parameters in the reliability model. This is accomplished by specifying the value of XY from 1 to 34. Each number corresponds to a particular parameter in

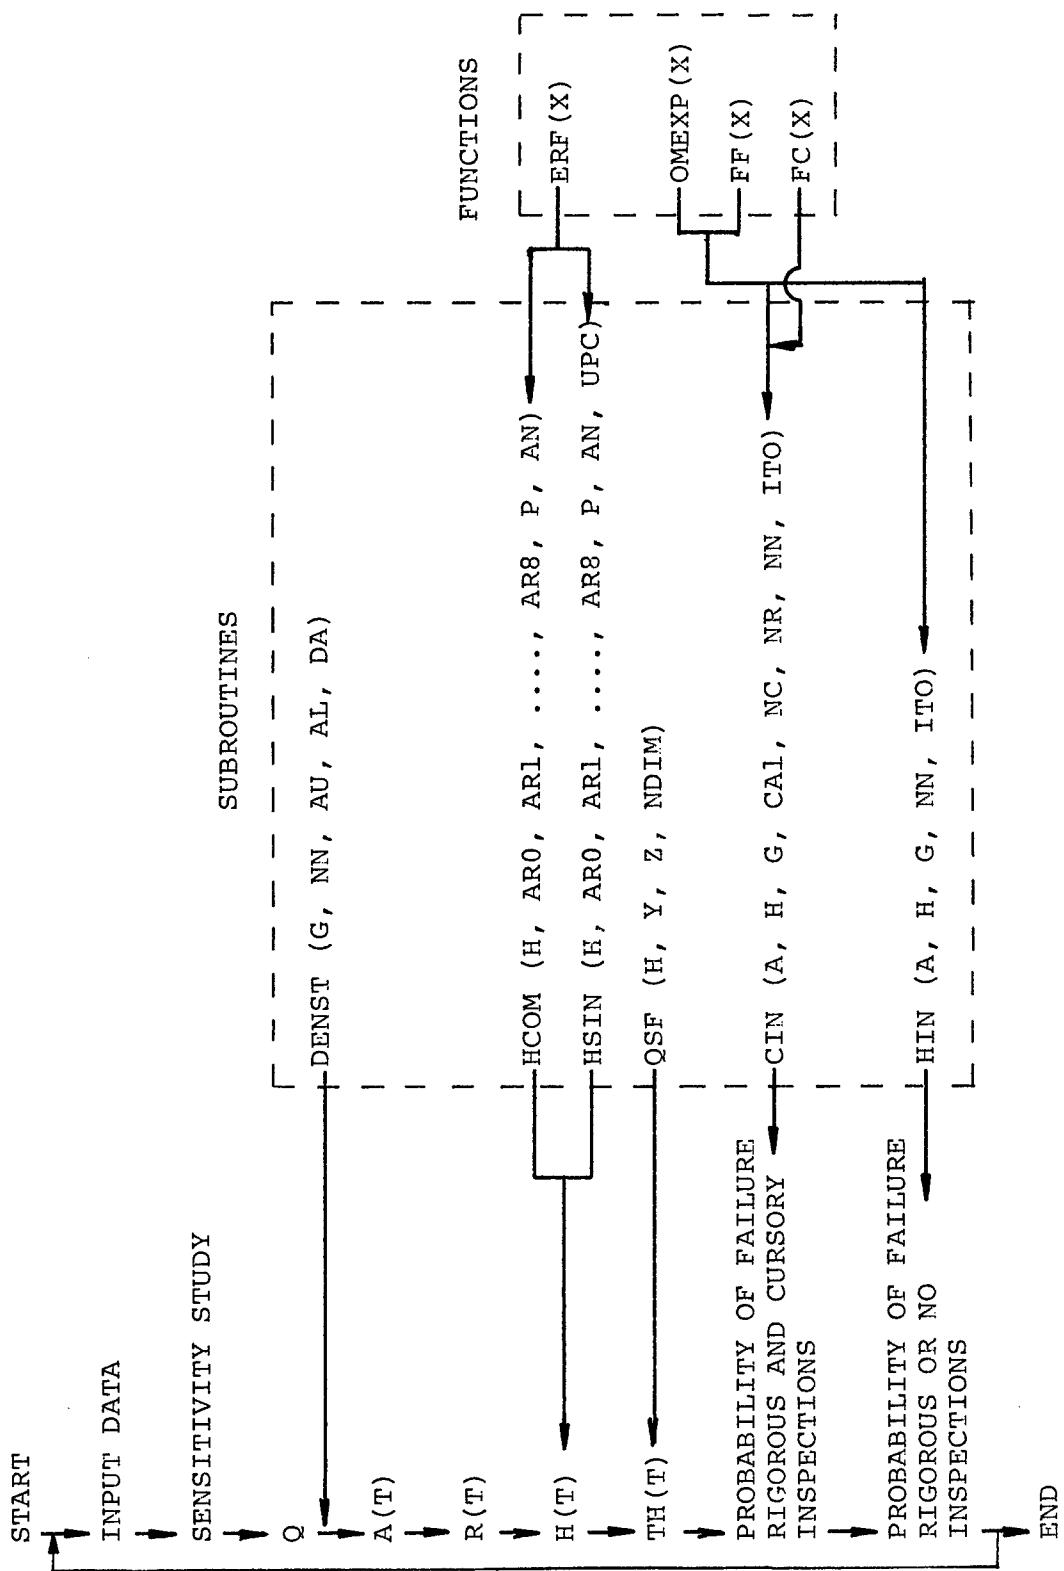


Figure 3. Simplified Flow Chart of the AREL2 Program

the system which are described in Sec. 4.1. The combined input load Q is determined in the same fashion as described in Sec. 3.2.1. Then with a call to subroutine DENST a probability density function G(A0) for the initial crack size A0 is generated. The crack size A(I), the residual strength R(I) and the failure rate H(I) are calculated in terms of A0 in a similar fashion as described in Sec. 3.2.1. The summation of the failure rate H(I) is obtained by calling subroutine QSF. The probability of first aircraft failure with rigorous and cursory inspections included is calculated from subroutine CIN. Similarly, the probability of first aircraft failure where no inspections or only rigorous inspections are performed is determined by calling subroutine HIN. The effect of proof test on the probability of failure is determined by specifying ACT to be equal or less than AU.

#### 4.2.2 Subroutine DENST (G, NN, AU, AL, DA)

Subroutine DENST calculates the probability density function G(A0) of the initial crack size A0. This is achieved by transforming the probability density function W(T) corresponding to the time to crack initiation. The output of the transformation is stored in G. The other arguments of the subroutine are

NN = number of division points on W and number of output points on G;

AU = maximum specified initial crack size value;

AL = lower limit crack size of G.

4.2.3 Subroutine HCOM (H, AR0, AR1, . . . , AR8, P, AN)

Same as described in Sec. 3.2.3.

4.2.4 Subroutine HSIN (H, AR0, AR1, . . . , AR8, P, AN, UPC)

Same as described in Sec. 3.2.4.

4.2.5 Subroutine QSF (H, Y, Z, NDIM)

Same as described in Sec. 3.2.5.

4.2.6 Subroutine CIN (A, H, G, CA1, NC, NR, NN, ITO)

Subroutine CIN determines probabilities of first aircraft failure with both rigorous and cursory inspections included. The arguments of the subroutine are

A = input data - fatigue crack size which is calculated  
in the main program;

H = summation of the failure rate;

G = probability density function of the initial crack  
size which is determined by subroutine DENST;

CA1 = minimum crack size which is detected by cursory  
inspection and is specified as input;

NC = number of cursory inspections in an interval between  
rigorous inspections;

NR = number of rigorous inspections;

NN = total number of inspections (cursory and rigorous);

ITO = an index for output print.

4.2.7 Subroutine HIN (A, H, G, NN, ITO)

Subroutine HIN calculates probabilities of first aircraft failure when no inspections or only rigorous inspections are performed. The meaning of the arguments for this subroutine

are the same as for subroutine CIN.

#### 4.2.8 Function ERF(X)

Function ERF(X) is the same as in AREL1 program.

#### 4.2.9 Function OMEXP(X)

Function OMEXP(X) evaluates  $OMEXP(X) = 1 - EXP(-X)$  utilizing an expansion procedure.

#### 4.2.10 Function FF(X)

Function FF(X) calculates the crack detection probability corresponding to rigorous type inspections. The necessary data for this function is specified in the main program.

#### 4.2.11 Function FC(X)

Function FC(X) specifies the crack detection probability for cursory inspection. The input argument in terms of the crack detection size is specified in the main program.

### 4.3 PROGRAM OUTPUT

The AREL2 program generates printed output. The input data XY, YZ1, YZ2, YZ3 is printed for a chosen example. The number of rigorous inspections NN, the crack size A, the failure rate H, the probability of first aircraft failure of a single airplane PA, and the probability of first aircraft failure TPA in a fleet of airplanes are printed as shown in Tables 9 and 10 corresponding to fail-safe and slow crack propagation models, respectively.

TABLE 9. CRACK SIZE A, FAILURE RATE H, PROBABILITY OF FAILURE  
FOR SINGLE AIRPLANE PA, PROBABILITY OF FAILURE IN A  
FLEET TPA (FAIL-SAFE)

NN= 14	A	H	PA	TPA
11	0.4270466E-01	0.4072061E-07	0.3394086E-07	0.1697041E-05
21	0.4667349E-01	0.9069237E-07	0.6815583E-07	0.3407785E-05
31	0.5364176E-01	0.1513895E-06	0.1024292E-06	0.5121445E-05
41	0.7546765E-01	0.2331089E-06	0.1367163E-06	0.6835792E-05
51	0.1582803E 01	0.5295597E-05	0.1710062E-06	0.8550273E-05
61	0.7000000E 01	0.5207602E 00	0.2053084E-06	0.1026537E-04
71	0.7000000E 01	0.1194295E 01	0.2396573E-06	0.1198279E-04
81	0.7000000E 01	0.1867827E 01	0.2740477E-06	0.1370229E-04
91	0.7000000E 01	0.2541360E 01	0.3084521E-06	0.1542248E-04
101	0.7000000E 01	0.3214892E 01	0.3428797E-06	0.1714383E-04
111	0.7000000E 01	0.3888425E 01	0.3773134E-06	0.1885550E-04
121	0.7000000E 01	0.4561957E 01	0.4117510E-06	0.2058732E-04
131	0.7000000E 01	0.5235490E 01	0.4461873E-06	0.2230910E-04
141	0.7000000E 01	0.5909022E 01	0.4806233E-06	0.2403087E-04
151	0.7000000E 01	0.6582555E 01	0.5150594E-06	0.2575263E-04

TABLE 10. CRACK SIZE A, FAILURE RATE H, PROBABILITY OF  
FAILURE FOR SINGLE AIRPLANE PA, PROBABILITY OF  
FAILURE IN A FLEET TPA (SLOW CRACK GROWTH)

NN= 14	A	H	PA	TPA
11	0.4270466E-01	0.3304082E-07	0.3304045E-07	0.1652020E-05
21	0.4667349E-01	0.6608151E-07	0.6607974E-07	0.3303981E-05
31	0.5364176E-01	0.9912242E-07	0.9911918E-07	0.4955946E-05
41	0.7546765E-01	0.1321632E-06	0.1321584E-06	0.6607897E-05
51	0.1582803E 01	0.1765910E-04	0.1651974E-06	0.8259838E-05
61	0.1000000E 04	0.7670562E 03	0.1984070E-06	0.9320299E-05
71	0.1000000E 04	0.1767055E 04	0.2322512E-06	0.1161249E-04
81	0.1000000E 04	0.2767054E 04	0.2671156E-05	0.1335569E-04
91	0.1000000E 04	0.3767052E 04	0.3021181E-06	0.1510579E-04
101	0.1000000E 04	0.4767039E 04	0.3372525E-05	0.1686247E-04
111	0.1000000E 04	0.5767020E 04	0.3725574E-06	0.1862769E-04
121	0.1000000E 04	0.6767000E 04	0.4078362E-06	0.2039160E-04
131	0.1000000E 04	0.7766980E 04	0.4431927E-06	0.2215938E-04
141	0.1000000E 04	0.8766961E 04	0.4785293E-06	0.2397617E-04
151	0.1000000E 04	0.9766941E 04	0.5138896E-06	0.2569414E-04

## APPENDIX A

```

C
C      MANUVER LOADING
C
C      DIMENSION A(32768), INV(4096), S(4096), BETA(6)
C      DIMENSION A1(8), A2(8), A3(8), A35(8), A4(8), A45(8), A5(8)
C      DIMENSION B1(8), B2(8), B3(8), B35(8), B4(8), B45(8), B5(8)
C      DIMENSION X1(6), X2(6), X3(6), X35(6), X4(6), X45(6), X5(6), XX(6,5)
C      DIMENSION Y1(6), Y2(6), Y3(6), Y35(6), Y4(6), Y45(6), Y5(6), YY(6,5)
C      DIMENSION NPK(8), MPK(8), NPEAK(6), MPEAK(6)
C      DIMENSION AA(8,5), BB(8,5), AN(5), BN(5)
C
C      COMMON /AXC/Z(200)
C      DATA BETA/0.0,0.25,0.5,0.75,0.8,0.9/
C      NSAMPL -- NO OF SAMPLES USED FOR EACH BETA VALUE
C      NBETA -- NO OF BETA VALUES
C      WUP -- UPPER BOUND FREQUENCY IN HERTZ
C      WL -- LOWER BOUND FREQUENCY IN HERTZ
C      N -- NO OF DIVISIONS IN SPECTRAL DENSITY
C      NPT -- NO OF SIMULATED TIME POINTS
C      M1 -- 2**M1=NPT
C      NSIGN -- 0 USE WHITE NOISE SPECTRUM
C              1 USE USER SUPPLY SPECTRUM
C      TIME -- TOTAL SIMULATED PERIOD IN SECONDS
C      REDUCE -- REDUCTION FACTOR OF THE NEGATIVE PART OF THE
C              TIME HISTORY
C
C      REDUCE=0.25
C      PI=3.141593
C      NSAMPL=8
C      NBETA=1
C      WUP=0.2
C      N=2048
C      NPT=16384
C      M1=14
C      NSIGN=1
C      DT=FLOAT(N)/(WUP*FLOAT(NPT))
C      WL=0.007
C      TIME=DT*NPT
C
C      CALL AREA TO FIND THE AREA OF SPECTRAL DENSITY IN ORDER TO
C      NORMALIZE S(W)
C      CALL AREA (S,512,WUP,WL)
C      A(1)=100000.
C      A(2)=0.
C      A(3)=.2
C      SCALE=1.0
C
C      CALL GRAPH (A,S,512,2,' ',2,' ',2,' ',2,' ',SCALE)
C      WRITE(6,312) TIME,DT,WUP,WL
312    FORMAT(10X,'PERIOD=',F10.2,4X,'DT=',F6.4,4X,'WU=',F5.3,
     1 4X,'WL=',F5.3/)
     NP=400
C      NPOTS -- NO OF POINTS IN EACH GRAPH
C      NPLOTS -- NO OF GRAPHS TO BE PLOTTED
C      NPOTS=1025
C      IX=3234567
C      DO 100 I=1,NBETA
C      WU=WUP

```

```

DO 80 J=1,NSAMPL
CALL SIMULT (A,N,NPT,WU,WL,IX,M1,NSIGN,INV,S)
DO 72 KK=1,NPT
IF(A(KK).LT.0.0) A(KK)=A(KK)*REDUCE
72 CONTINUE
WRITE(6,20)
20 FORMAT(1H1)
IF (J.GT.1) GO TO 15
C WRITE OUT PART OF THE SAMPLE TIME HISTORY (1ST SAMPLE)
NS=NPT/8
WRITE(6,74) (A(I),I=1,NS)
74 FORMAT((1X,24F5.2))
CALL PLOT (NP,DT,A,0.0,1)
15 CALL PICK (A,NPT,S,NPK(J))
CALL STDEVI(1,NPK(J),S,STD,RMS,A1(J),A2(J),A3(J),A35(J)
1 ,A4(J),A45(J),A5(J),AN)
DO 34 L=1,5
34 AA(J,L)=AN(L)
WRITE(6,25) BETA(I),NPK(J),WU,WL,STD,RMS
25 FORMAT(//5X,'BETA=',F6.3,5X,'NPEAK=',I6,5X,'WU='
1 F8.4,5X,'WL=',F8.4,5X,'STDEV=',E14.7,5X,'RMS=',E14.7/)
WRITE(6,30) A1(J),A2(J),A3(J),A35(J),A4(J),A45(J),A5(J),
1 (AA(J,L),L=1,5)
30 FORMAT(5X,'MEAN1=',F7.3,3X,'MEAN2=',F7.3,3X,'MEAN3=',F7.3,
1 3X,'MEAN35=',F7.3,3X,'MEAN4=',F7.3,3X,'MEAN45=',F8.3,
2 3X,'MEAN5=',F8.3/5X,'MEAN6=',E12.5,2X,'MEAN7=',E12.5,2X,
3 'MEAN8=',E12.5,2X,'MEAN9=',E12.5,2X,'MEAN10=',E12.5/)
C WRITE(6,70) (A(L),L=1,NP)
C 70 FORMAT(/10(2X,F10.5))
C WRITE(6,70) (S(L),L=1,50)
CALL PICKM (A,NPT,S,MPK(J))
CALL STDEVI(1,MPK(J),S,STD,RMS,B1(J),B2(J),B3(J),B35(J),
1 B4(J),B45(J),B5(J),BN)
DO 44 L=1,5
44 BB(J,L)=BN(L)
WRITE(6,25) BETA(I),MPK(J),WU,WL,STD,RMS
WRITE(6,30) B1(J),B2(J),B3(J),B35(J),B4(J),B45(J),B5(J),
1 ,(BB(J,L),L=1,5)
C WRITE(6,70) (S(L),L=1,50)
CALL STATIS (A,NPT,STDV,RMSV)
C TO FIND THE STANDARD DEVIATION OF THE PROCESS
WRITE(6,212) STDV,RMSV
212 FORMAT(//5X,'STANDARD DEVIATION OF THE TIME HISTORY'
1 //5X,'STDEV=',E14.7,5X,'R.M.S.=',E14.7)
80 CONTINUE
NSAM=NSAMPL
CALL MEANT (NSAM,A1,A2,A3,A35,A4,A45,A5,AM1,AM2,AM3,
1 AM35,AM4,AM45,AM5,AA,AN)
WRITE(6,95) AM1,AM2,AM3,AM35,AM4,AM45,AM5,(AN(L),L=1,5)
95 FORMAT(///10X,'AM ',6(3X,E14.7)/15X,6(3X,E14.7)/)
X1(I)=AM1
X2(I)=AM2
X3(I)=AM3
X35(I)=AM35
X4(I)=AM4
X45(I)=AM45

```

```

X5(I)=AM5
DO 82 L=1,5
82 XX(I,L)=AN(L)
CALL MEAN7 (NSAM,B1,B2,B3,B35,B4,B45,B5,BM1,BM2,BM3,
1 BM35,BM4,BM45,BM5,BB,BN)
WRITE(6,96) BM1,BM2,BM3,BM35,BM4,BM45,BM5,(BN(L),L=1,5)
96 FORMAT(//10X,'BM ',6(3X,E14.7)/15X,6(3X,E14.7)//)
Y1(I)=BM1
Y2(I)=BM2
Y3(I)=BM3
Y35(I)=BM35
Y4(I)=BM4
Y45(I)=BM45
Y5(I)=BM5
DO 81 L=1,5
81 YY(I,L)=BN(L)
NPEAK(I)=0
MPEAK(I)=0
DO 98 I=1,NSAM
NPEAK(I)=NPEAK(I)+NPK(II)
98 MPEAK(I)=MPEAK(I)+MPK(II)
NPEAK(I)=NPEAK(I)/FLOAT(NSAM)
MPEAK(I)=MPEAK(I)/FLOAT(NSAM)
100 CONTINUE
WRITE(6,105)
105 FORMAT(1H1///42X,'CASE I'//)
WRITE(6,106)
106 FORMAT(30X,'AVERAGE OF POWER OF RISE AND FALL'/
1 /30X,' AND NUMBER OF RISE AND FALL '//43X,'POWER')/
WRITE(6,110)
110 FORMAT(15X,'1.0',5X,'2.0',5X,'3.0',5X,'3.5',5X,'4.0',
1 5X,'4.5',5X,'5.0',5X,'RISE & FALL'/6X,'BETA')
DO 120 I=1,NBETA
120 WRITE(6,140) BETA(I),X1(I),X2(I),X3(I),X35(I),X4(I),
1 X45(I),X5(I),NPEAK(I)
140 FORMAT(/6X,F4.2,2X,7F8.3,2X,I7)
141 FORMAT(/6X,F4.2,2X,5(F10.3,1X),2X,I6)
WRITE(6,145)
145 FORMAT(1H1///42X,'CASE II'//)
WRITE(6,106)
WRITE(6,110)
DO 150 I=1, NBETA
150 WRITE(6,140) BETA(I),Y1(I),Y2(I),Y3(I),Y35(I),Y4(I)
1 ,Y45(I),Y5(I),MPEAK(I)
WRITE(6,105)
WRITE(6,106)
WRITE(6,111)
111 FORMAT(15X,'6.0',8X,'7.0',8X,'8.0',8X,'9.0',8X,'10.',
1 8X,'PEAKS'/6X,'BETA')
DO 121 I=1,NBETA
121 WRITE(6,141) BETA(I),(XX(I,L),L=1,5),NPEAK(I)
WRITE(6,145)
WRITE(6,106)
WRITE(6,111)
DO 151 I=1,NBETA
151 WRITE(6,141) BETA(I),(YY(I,L),L=1,5),MPEAK(I)

```

```

STDEV=1.
CALL PICKMX (A,NPT,S(1),LLL,S(2049),MMM)
WRITE(6,123) LLL,(S(L),L=1,LLL)
WRITE(6,124) MMM,(S(L+2048),L=1,MMM)
123 FORMAT(1H1/10X,'NO. OF PEAKS=',I6/(2X,10F8.4))
124 FORMAT(1H1/10X,'NO. OF TROUGHS=',I6/(2X,10F8.4))
C      RATIO -- 1 GIVE TOTAL CROSSINGS OF THE HISTORY
C      3600/PERIOD GIVE CROSSINGS PER HOUR
C      RATIO=1.
CALL CROSS (STDEV,S(1),S(2049),LLL,MMM,VZERO,RATIO)
RATIO=3600./TIME
CALL CROSS (STDEV,S(1),S(2049),LLL,MMM,VZERO,RATIO)
STOP
END

```

```

SUBROUTINE STDEVI(NST,NPT,FUN,STD,RMS,A1,A2,A3,A35,A4,A45,A5,AN)
DIMENSION FUN(1),AN(1)
ASUM1=0.0
ASUM2=0.0
ASUM3=0.0
ASUM35=0.0
ASUM4=0.0
ASUM45=0.0
ASUM5=0.0
DO 10 I=1,5
10 AN(I)=0.0
XPOINT=FLOAT(NPT-NST+1)
DO 5 JT=NST,NPT
AA2=FUN(JT)*FUN(JT)
AA3=FUN(JT)*AA2
AA35=FUN(JT)**3.5
AA4=AA2*AA2
AA45=FUN(JT)**4.5
AA5=AA3*AA2
ASUM1=ASUM1+FUN(JT)
ASUM2=ASUM2+AA2
ASUM3=ASUM3+AA3
ASUM35=ASUM35+AA35
ASUM4=ASUM4+AA4
ASUM45=ASUM45+AA45
ASUM5=ASUM5+AA5
AN(1)=AN(1)+AA3*AA3
AN(2)=AN(2)+AA35*AA35
AN(3)=AN(3)+AA4*AA4
AN(4)=AN(4)+AA45*AA45
AN(5)=AN(5)+AA5*AA5
5 CONTINUE
A1=ASUM1/XPOINT
A2=ASUM2/XPOINT
A3=ASUM3/XPOINT
A35=ASUM35/XPOINT
A4=ASUM4/XPOINT
A45=ASUM45/XPOINT
A5=ASUM5/XPOINT

```

```
DO 15 K=1,5
15 AN(K)=AN(K)/XPOINT
RMS=SQRT(A2)
STD=SQRT(A2-A1*A1)
RETURN
END
```

```
SUBROUTINE MEANT (NSAMPL,A1,A2,A3,A35,A4,A45,A5,AM1,AM2,
1 AM3,AM35,AM4,AM45,AM5,AA,AN)
DIMENSION A1(1),A2(1),A3(1),A35(1),A4(1),A45(1),A5(1)
DIMENSION AA(8,5),AN(5)
AM1=0.
AM2=0.
AM3=0.
AM35=0.
AM4=0.
AM45=0.
AM5=0.
DO 10 I=1,5
10 AN(I)=0.
DO 90 K=1,NSAMPL
AM1=AM1+A1(K)
AM2=AM2+A2(K)
AM3=AM3+A3(K)
AM35=AM35+A35(K)
AM4=AM4+A4(K)
AM45=AM45+A45(K)
AM5=AM5+A5(K)
DO 80 L=1,5
80 AN(L)=AN(L)+AA(K,L)
90 CONTINUE
SAMPL=FLOAT(NSAMPL)
AM1=AM1/SAMPL
AM2=AM2/SAMPL
AM3=AM3/SAMPL
AM35=AM35/SAMPL
AM4=AM4/SAMPL
AM45=AM45/SAMPL
AM5=AM5/SAMPL
DO 85 L=1,5
85 AN(L)=AN(L)/SAMPL
RETURN
END
```

SUBROUTINE PICK (A,NP,PEAK,NPK)

C  
C    PICK UP DIFFERNECE BETWEEN SUCESSIVE RISE AND FALL  
C    A    -- INPUT ARRAY FROM WHICH RISE AND FALL ARE TO BE FOUND  
C    NP   -- NO OF POINTS IN INPUT ARRAY A  
C    PEAK -- ARRAY TO STORE THE RESULT OF (PEAK(I)-TROUGH(I-1))  
C    NPK -- NUMBER OF VALUE FOUND  
  
C  
DIMENSION A(1),PEAK(1)  
PEAK(1)=A(1)  
IFLAG=1  
IF(A(1).GT.A(2)) IFLAG=0  
IPK=2  
DO 100 I=1,NP  
IF(IFLAG.LT.1) GO TO 60  
C    PEAK TESTING  
IF(A(I).LT.A(I+1)) GO TO 100  
PEAK(IPK)=A(I)  
PEAK(IPK-1)=ABS(PEAK(IPK)-PEAK(IPK-1))  
IPK=IPK+1  
IFLAG=0  
GO TO 100  
C    TROUGH TESTING  
60 IF(A(I).GT.A(I+1)) GO TO 100  
PEAK(IPK)=A(I)  
PEAK(IPK-1)=ABS(PEAK(IPK)-PEAK(IPK-1))  
IPK=IPK+1  
IFLAG=1  
100 CONTINUE  
NPK=IPK-2  
RETURN  
END

SUBROUTINE PICKM (A,NP,PEAK,MPK)

C  
C    PICK UP THE DIFFERENCES BETWEEN SUCESSIVE MAXIMUM RISE AND  
C    MINIMUN FALL ( 2ND METHOD OF PICKING)  
  
C    A    -- INPUT ARRAY FROM WHICH RISE AND FALL ARE TO BE PICKED  
C    NP   -- NUMBER OF POINTS OF INPUT ARRAY A  
C    PEAK -- ARRAY USE TO HOLD THE RISE AND FALL DIFFERENCES  
C    MPK -- NUMBER OF RISE AND FALL DIFFERNENCE FOUND  
  
C  
DIMENSION A(1),PEAK(1)  
AMAX=0.  
AMIN=0.  
IFLAG=1  
IF(A(1).LT.0.) IFLAG=0  
IPK=1

```

DO 100 I=1,NP
IF(IFLAG.EQ.0) GO TO 40
IF(A(I).GT.AMAX) AMAX=A(I)
IF(A(I+1).LT.0.) GO TO 50
GO TO 100
50 IFLAG=0
PEAK(IPK)=ABS(AMAX-AMIN)
IPK=IPK+1
AMIN=1.0
GO TO 100
40 IF(A(I).LT.AMIN) AMIN=A(I)
IF(A(I+1).GT.0.) GO TO 70
GO TO 100
70 IFLAG=1
PEAK(IPK)=ABS(AMAX-AMIN)
IPK=IPK+1
AMAX=-1.0
100 CONTINUE
MPK=IPK-1
RETURN
END

```

#### SUBROUTINE PICKC (NPT,Y,PMAX,PMIN,LPEAK,MTROG)

```

C
C      TO PICK UP PEAKS AND TROUGHS FROM A PROCESS
C      Y -- INPUT PROCESS FROM WHICH PEAKS AND TROUGHS ARE TO BE
C            FOUND
C      NPT - NO OF INPUT POINTS OF Y
C      PMAX -- ARRAY USE TO HOLD SUCESSIVE PEAKS VALUE
C      PMIN -- ARRAY USE TO HOLD SUCESSIVE TROUGH VALUES
C      LPEAK -- NUMBER OF PEAKS FOUND
C      MTROG -- NUMBER OF TROUGHS FOUND
C
C      DIMENSION Y(1),PMAX(1),PMIN(1).
I=1
L=1
M=1
100 IF((I+1).GE.NPT) GO TO 30
25 IF(Y(I).GT.Y(I+1)) GO TO 13
20 IF(Y(I).GT.Y(I+1)) GO TO 15
35 IF(I.GE.NPT) GO TO 100
14 I=I+1
GO TO 20
15 PMAX(L)=Y(I)
L=L+1
GO TO 100
13 IF(Y(I).LE.Y(I+1)) GO TO 16
33 IF(I.GE.NPT) GO TO 100
18 I=I+1
GO TO 13
16 PMIN(M)=Y(I)
M=M+1
GO TO 100
30 LPEAK=L-1
MTROG=M-1
RETURN
END

```

```

SUBROUTINE AREA (S,NPT,FU,FL)
DIMENSION S(1)
COMMON ANORML
C
C      ANORML -- AREA OF THE SPECTRUM
C
C      FU -- UPPER CUTOFF FREQUENCY IN HERTZ
C      FL -- LOWER   "        "      "      "
C
C      ANORML=1.0
C      PI2=2.0*3.141593
C      WUP=PI2*FU
C      WLR=PI2*FL
C      DW=WUP/FLOAT(NPT)
C      NUMP=INT(WLR/DW)
C      IF(NUMP.EQ.0) NUMP=1
C      DO 45 I=1,NPT
C      45 S(I)=0.
C      DO 48 I=NUMP,NPT
C      WI=FLOAT(I)*DW
C      CALL FUNSPT (SP,WI)
C      48 S(I)=SP
C      USE SIMPSN RULE TO COMPUTE THE AREA UNDER THE CURVE
C      NPP=NPT
C      IF(NPP/2*2.EQ.NPP) NPP=NPP-1
C      CALL SIMPSN (S,NPP,DW,SAREA)
C      ANORML=SAREA
C      WRITE(6,60) SAREA,FU,FL,WUP,WLR,(S(I),I=1,128)
C      60 FORMAT(10X,'AREA=',E14.7,5X,4(4X,F6.4)/8(2X,F8.4))
C      RETURN
C      END

```

---

```

SUBROUTINE SIMPSN (AF,NPT,DSTEP,SIMP)
DIMENSION AF(1)
C
C      NPT -- NO. OF POINTS FOR INTEGRATION (MUST BE ODD NO.)
C      SIMP -- RESULTING AREA OF INTEGRATION
C
C      NP=(NPT-1)/2
C      MN=NP-1
C      ODD=0.
C      EVEN=0.
C      END=AF(1)+AF(NPT)
C      DO 10 I=1,NP
C      10 ODD=ODD+AF(2*I)
C      DO 20 I=1,MN
C      20 EVEN=EVEN+AF(2*I+1)
C      SIMP=(4.0*ODD+2.0*EVEN+END)*DSTEP/3.0
C      RETURN
C      END

```

---

```

SUBROUTINE CROSS (STDEV,PMAX,PMIN,LLL,MMM,VZERO,RATIO)
DIMENSION COUNT(51),PMAX(1),PMIN(1)
INTEGER COUNT,SIGN

C TO FIND CROSSINGS OF A PROCESS (INCLUDES +VE AND -VE SLOPS)
C WE START CROSSINGS FROM THE FIRST TROUGH
C
C STDEV -- STANDARD DEVIATION OF THE PROCESS
C PMAX -- PEAK VALUE ARRAY OF THE PROCESS
C PMIN -- TROUGH VALUE ARRAY OF THE PROCESS
C LLL -- NO OF PEAKS
C MMM -- NO OF TROUGHS
C VZERO -- ZERO CROSSINGS
C RATIO -- SET TO 1 IF CROSSINGS FOR THE WHOLE PERIOD OF THE
C          PROCESS IS TO BE FOUND
C          SET TO 3600/PERIOD IF CROSSINGS/HOUR IS TO BE
C          FOUND

```

```

KL=1
STDEV5=STDEV/5.0
DO 4 I=1,51
 4 COUNT(I)=0
100 XXX=PMIN(KL)/STDEV5
      YYY=PMAX(KL)/STDEV5
      II=XXX
      II=II+26
      IF(PMIN(KL).LE.0.) GO TO 11
15  II=II+1
11  KK=YYY
      KK=KK+26
      IF(PMAX(KL).GT.0) GO TO 14
12  KK=KK-1
14  IF(KK.LE.51) GO TO 28
33  KK=51
28  IF(II) 31,31,22
31  II=1
22  IF(II.GT.51) GO TO 38
20  COUNT(II)=COUNT(II)+1
38  II=II+1
      IF(II.LE.KK) GO TO 20
25  XXX=PMIN(KL+1)/STDEV5
      YYY=PMAX(KL)/STDEV5
      IJ=XXX
      IJ=IJ+26
      IF(PMIN(KL+1).LE.0.0) GO TO 21
45  IJ=IJ+1
21  KJ=YYY
      KJ=KJ+26
      IF(PMAX(KL).GT.0.0) GO TO 75
74  KJ=KJ-1
75  IF(KJ-51) 65,65,70
70  KJ=51
65  IF(IJ) 60,60,90
60  IJ=1
90  IF(IJ.GT.51) GO TO 82

```

```

80 COUNT(IJ)=COUNT(IJ)+1
82 IJ=IJ+1
    IF(IJ.LE.KJ) GO TO 80
72 KL=KL+1
    IF(KL-MMM) 100,400,400
400 WRITE(6,500)
500 FORMAT(1H1,5X,'NUMBER OF TOTAL CROSSINGS AT DIFFERENT LEVEL OF'
1,' SIGMA,' /6X,'INCLUDES CROSSINGS WITH BOTH +VE AND -VE SLOP'//
2 6X,'SIMULATED RESULT'//)
177 Z1=-5.0
DO 66 I=1,51
COUNT(I)=IFIX(FLCAT(COUNT(I))*RATIO)
WRITE(6,600) Z1,COUNT(I)
Z1=Z1+.2
66 CONTINUE
VZERO=COUNT(26)
600 FORMAT(5X,F4.1,'SIGMA=',I6,2X,'CROSSINGS')
RETURN
END

```

C SUBROUTINE SIMULT

C PURPOSE

C PERFORMS SIMULATION OF RANDOM SAMPLE FUNCTION BY THE USE  
C OF FAST FOURIER TRANSFORM METHOD

C USAGE

C CALL SIMULT(A,N,NPT,NPT2,NPT4,WU,WL,IX,M1,NSIGN,S,INV)

C DESCRIPTION OF PARAMETERS

C A --A IS THE OUTPUT SAMPLE FUNCTION IN TIME DOMAIN

C IT IS A ONE-DIMENSION ARRAY

C N --N IS THE NUMBER OF SUBDIVISIONS OF A GIVEN SPECTRUM  
C SS(W),AND N MUST BE A NUMBER OF POWER OF 2

C THAT IS N=2\*\*M ,M IS A POSITIVE INTEGER

C NPT --NPT IS THE NUMBER OF POINTS OF THE OUTPUT SAMPLE  
C FUNCTION SPECIFIED AS INPUT NPT=2\*\*M1 WITH

C 2\*N EQUAL TO OR LESS THAN NPT

C NPT2 --NPT2 IS AN INTEGER INPUT EQUAL TO 2\*NPT

C NPT4 --NPT4 IS EQUAL TO ONE-FOURTH OF NPT AND MUST

C BE SPECIFIED AS INPUT

C FU --FU IS THE UPPER BOUND FREQUENCY IN HERTZ OF THE  
C GIVEN SPECTRUM SS(W) ,MUST BE SPECIFIED

C FL --FL IS THE LOWER BOUND FREQUENCY IN HERTZ OF THE  
C GIVEN SPECTRUM SS(W) ,MUST BE SPECIFIED

C IX --AN ODD INTEGER INPUT LESS THAN 9 DIGITS,BY CHANGING  
C IX,WE WILL GET A DIFFERENT SAMPLE FUNCTION FOR A

C GIVEN N

C M1 --AN POSITIVE INTEGER INPUT SUCH THAT NPT=2\*\*M1

C NSIGN --AN OPTION PARAMETER

C 0 USE WHITE NOISE SPECTRUM PROVIDE BY THE  
C SUBROUTINE SIMULT WITH FREQUENCY DOMAIN WU TO  
C WL TO SIMULATE THE SAMPLE FUNCTION, AND THE  
C SAMPLE FUNCTION IS NORMALIZED WITH MEAN=0 AND  
C STANDARD DEVIATION=1

C 1 USER WILL HAVE TO PROVIDE SPECTRUM SS(W) FOR  
C SUBROUTINE FUNSPT AND THE SAMPLE FUNCTION  
C SIMULATED IS NOT NORMALIZED BUT THE MEAN IS  
C STILL ZERO

C REMARKS

C THIS SUBROUTINE WILL GIVE A UP TO  $2^{**M1}$  POINTS  
C WITH M1 MUST NOT BE LESS THAN 3 OR GREATER THAN 20

C SUBROUTINES AND FUNCTIONS REQUIRED

C HARM RANDU,FUNSPT

C METHOD

C N

C  $F(T) = \sum_{K=1}^N \text{SQRT}(2.0 * \text{SS}(W(K)) * \exp(i * \text{PHI}(K)) * \exp(i * W(K) * T)$

C I=IMAGINARY NUMBER    T=TIME    PHI =RANDOM PHASE ANGLE  
C AND

C  $A(T) = \text{SQRT}((WU-WL)/N) * \text{REAL}(F(T))$

C FOR N SUBDIVISIONS OF SPECTRUM, FFT ONLY GIVE N POINTS OF  
C TIME HISTORY, THAT IS ONE COMPLETE PERIOD, THEREFORE THE  
C RESOLUTION OF THE PROCESS IS BAD. TO IMPROVE THE RESOLUTION  
C WE HAVE TO ADD  $\text{SS}(W(K))=0$   $K=N+2, \dots, NPT$  AFTER  $\text{SS}(WU)$   
C THE TIME INCREMENT DTIME IS

C  $DTIME = 1.0 / W(NPT)$     W=FREQUENCY

C NOTE:     $\text{SS}(W)$  HAS PRESCRIBED VALUE ONLY UP TO N POINTS  
C IF PHI ARE FIXED UP TO K=N, THE SAMPLE FUNCTION  
C WILL BE THE SAME, THE ONLY THING CHANGES IS DTIME.  
C THEREFORE WHEN WE INCREASE NPT WE DECREASE DTIME.  
C A,S,AND INV HAVE TO BE DIMENSIONED IN THE MAIN  
C PROGRAM ACCORDINGLY.

C \*\*\*\*  
C \*\*\*\*  
C SUBROUTINE SIMULT(A,N,NPT,FU,FL,IX,M1,NSIGN,INV,S)

C DIMENSION A(1),M(3),INV(1),S(1)

C PI=3.141593

C NL=256

C CONVERT HERTZS INTO RADIANS

C  $WU = FU * 2.0 * PI$

C  $WL = FL * 2.0 * PI$

C  $DW = WU / FLOAT(N)$

C  $NUMP = INT(WL / DW)$

C  $WL = DW * NUMP$

```

IF(NUMP.EQ.0) NUMP=1
SQRT=SQRT(2.0*WU/((WU-WL)*FLOAT(N)))
M(1)=M1
M(2)=0
M(3)=0
IFSET=1
DO 5 I=1,NUMP
A(I*2-1)=0.0
A(I*2)=0.0
5 CONTINUE
NN=N+2
DO 10 I=NN,NPT
A(2*I-1)=0.0
A(2*I)=0.0
10 CONTINUE
IF(NSIGN.EQ.1) GO TO 40
C
C TO GENERATE RANDOM PHASE ANGLES PHI
C
DO 30 I=NUMP,N
CALL RANDU (IX,IY,YFL)
IX=IY
PHI=2.0*PI*YFL
A(2*I+1)=COS(PHI)
A(2*I+2)=SIN(PHI)
30 CONTINUE
GO TO 60
40 DO 50 J=NUMP,N
W1=FLOAT(J)*DW
CALL FUNSPT (SP,W1)
CALL RANDU (IX,IY,YFL)
IX=IY
PHI=2.0*PI*YFL
A(2*j+1)=SQRT(2.0*SP)*COS(PHI)
A(2*j+2)=SQRT(2.0*SP)*SIN(PHI)
50 CONTINUE
C
C START SIMULATING SAMPLE FUNCTION FOR A GIVEN SET OF PHI
C
60 CALL HARM (A,M,INV,S,IFSET,IFERR)
IF(NSIGN.EQ.1) GO TO 80
C
C SAMPLE FUNCTION FROM SS(W) EQUAL TO WHITE NOISE
C
DO 70 I=1,NPT
A(I)=A(2*I-1)*SQRT
70 CONTINUE
GO TO 100
C
C SAMPLE FUNCTION FROM A SPECIFIED SS(W)
C
80 DO 90 I=1,NPT
A(I)=A(2*I-1)*SQRT(DW)
90 CONTINUE
100 RETURN
END

```

SUBROUTINE FUNSPT (SP,W1)

```
C
C SS(W)=... IS A FUNCTION STATEMENT NONEXECUTABLE AND MUST BE
C SUPPLIED BY THE USER. SS(W) IS THE SPECTRAL DENSITY FUNCTION
C
COMMON ANORML
SS(W)=PI2*PHIO/(1.0+(PI2*W/FB)**A)/ANORML
PI2=1.0/(2.*3.141593)
PHIO=30
FB=0.031
A=2.6
SP=SS(W1)
RETURN
END
```

SUBROUTINE PLOT (NPT,H,FUN,FACT,NSTEP)

```
C
C NPT----NO. OF POINTS TO BE PLOTTED
C FUN---FUNCTION TO BE PLOTTED
C H-----TIME INTERVAL (TO 2 DECIMAL PLACES)
C REMARK: TITLE AND DIMENSION OF FUNCTION HAVE TO BE PRINTED OUT BEFORE
C CALLING PLOT
C REMARK: IF FACT=0., THEN SCALE FACTOR IS COMPUTED BASED ON THE GIVEN
C FUNCTION, OTHERWISE SCALE FACTOR=FACT
```

```
DIMENSION ALINE(120),FUN(NPT),DAS(120),SCALE(11)
DATA DASH/'-'/,STAR/*'/,BAR/'|'/,BLANK/' '/
```

```
C
C DETERMINE THE SCALE FACTOR
C
```

```
IF(FACT.EQ.0.) GO TO 30
FACTOR=FACT
GO TO 80
30 AMAX=1.0E-70
DO 40 I=1,NPT,NSTEP
IF(ABS(FUN(I)).GT.AMAX) AMAX=ABS(FUN(I))
40 CONTINUE
FACTOR=AMAX/50.0
```

```
C
C START TO PLOT
C
```

```
80 DO 95 I=1,11
95 SCALE(I)=-60.+10.*FLOAT(I)
DO 100 I=1,120
100 DAS(I)=DASH
DO 105 I=15,115,10
105 DAS(I)=BAR
DO 110 I=10,120
110 ALINE(I)=BLANK
ALINE(65)=BAR
WRITE(6,200) FACTOR
WRITE(6,302) SCALE
WRITE(6,303) (DAS(I),I=10,120)
```

```

DO 120 I=1,NPT,NSTEP
TIME=H*FLOAT(I-1)
NP=FUN(I)/FACTOR+65.
ALINE(NP)=STAR
WRITE(6,304) TIME,(ALINE(J),J=10,120)
ALINE(NP)=BLANK
IF(NP.EQ.65) ALINE(65)=BAR
120 CONTINUE
200 FORMAT(///,50X,'SCALE FACTOR=', E11.3)
302 FORMAT(1H0,2X,'TIME',5X,5(F4.0,6X),1X,6(F3.0,7X))
303 FORMAT (1H ,8X,114A1)
304 FORMAT(1H ,F8.4,111A1)
RETURN
END

```

#### SUBROUTINE PICKMX(A,NP,PEAK,MPK,TROUG,NPK)

```

C
C      PICK UP THE DIFFERENCES BETWEEN SUCESSIVE MAXIMUM RISE AND
C      MINIMUN FALL ( 2ND METHOD OF PICKING)
C
C      A      -- INPUT ARRAY FROM WHICH RISE AND FALL ARE TO BE PICKED
C      NP     -- NUMBER OF POINTS OF INPUT ARRAY A
C      PEAK   -- ARRAY USE TO HOLD THE RISE AND FALL DIFFERENCES
C      MPK    -- NUMBER OF RISE AND FALL DIFFERNCE FOUND
C
DIMENSION A(1),PEAK(1),TROUG(1)
AMAX=0.
AMIN=0.
IFLAG=1
IF(A(1).LT.0.) IFLAG=0
IPK=1
ITK=1
NST=1
IF(IFLAG.EQ.0) GO TO 20
DO 10 I=1,NP
IF(A(I).LT.0.0) GO TO 15
10 CONTINUE
15 NST=I
IFLAG=0
20 DO 100 I=NST,NP
IF(IFLAG.EQ.0) GO TO 40
IF(A(I).GT.AMAX) AMAX=A(I)
IF(A(I+1).LT.0.) GO TO 50
GO TO 100
50 IFLAG=0
PEAK(IPK)=AMAX
IPK=IPK+1
AMIN=1.0
GO TO 100

```

```
40 IF(A(I).LT.AMIN) AMIN=A(I)
    IF(A(I+1).GT.0.) GO TO 70
    GO TO 100
70 IFLAG=1
    TROUG(ITK)=AMIN
    ITK=ITK+1
    AMAX=-1.0
100 CONTINUE
    MPK=IPK-1
    NPK=ITK-1
    RETURN
    END
```

```
SUBROUTINE STATIS (A,NP,STD,RMS)
DIMENSION A(1)
C
C      TO FIND THE STANDARD DEVIATION AND RMS VALUES OF A PROCESS
C
AS=0.
AS2=0.
DO 10 I=1,NP
AS=AS+A(I)
AS2=AS2+A(I)*A(I)
10 CONTINUE
AS=AS/FLOAT(NP)
AS2=AS2/FLOAT(NP)
STD=SQRT(AS2-AS*AS)
RMS=SQRT(AS2)
RETURN
END
```

```
SUBROUTINE RANDU(IX,IY,YFL)
IY=IX*65539
IF(IY) 5,6,6
5 IY=IY+2147433647+1
6 YFL=IY
YFL=YFL*0.4656613D-9
RETURN
END
```

```

SUBROUTINE HARM(A,M,INV,S,IFSET, IFERR,NPT2,NPT4)
DIMENSION A(NPT2),INV(NPT4),S(NPT4),N(3),M(3),NP(3),W(2),W2(2),
1W3(2)
EQUIVALENCE (N1,N(1)),(N2,N(2)),(N3,N(3))
10 IF( IABS(IFSET) - 1) 500,900,12
12 MTT=MAX0(M(1),M(2),M(3)) -2
ROOT2 = SQRT(2.)
IF (MTT-MT ) 14,14,13
13 IFERR=1
RETURN
14 IFERR=0
M1=M(1)
M2=M(2)
M3=M(3)
N1=2**M1
N2=2**M2
N3=2**M3
16 IF(IFSET) 18,18,20
18 NX= N1*N2*N3
FN = NX
DO 19 I = 1,NX
A(2*I-1) = A(2*I-1)/FN
19 A(2*I) = -A(2*I)/FN
20 NP(1)=N1*2
NP(2)= NP(1)*N2
NP(3)=NP(2)*N3
DO 250 ID=1,3
IL = NP(3)-NP(ID)
IL1 = IL+1
MI = M(ID)
IF (MI)250,250,30
30 IDIF=NP(ID)
KBIT=NP(ID)
MEV = 2*(MI/2)
IF (MI - MEV )60,60,40
40 KBIT=KBIT/2
KL=KBIT-2
DO 50 I=1,IL1,1
KLAST=KL+I
DO 50 K=I,KLAST,2
KD=K+KBIT
T=A(KD)
A(KD)=A(K)-T
A(K)=A(K)+T
T=A(KC+1)
A(KD+1)=A(K+1)-1
50 A(K+1)=A(K+1)+T
IF (MI - 1)250,250,52
52 LFIRST =3
JLAST=1
GO TO 70
60 LFIRST = 2
JLAST=0

```

```

70 DO 240 L=LFIRST,MI,2
  JJDIF=KBIT
  KBIT=KBIT/4
  KL=KBIT-2
  DO 80 I=1,IL1,ICIF
  KLAST=I+KL
  DO 80 K=I,KLAST,2
  K1=K+KBIT
  K2=K1+KBIT
  K3=K2+KBIT
  T=A(K2)
  A(K2)=A(K)-T
  A(K)=A(K)+T
  T=A(K2+1)
  A(K2+1)=A(K+1)-T
  A(K+1)=A(K+1)+T
  T=A(K3)
  A(K3)=A(K1)-T
  A(K1)=A(K1)+T
  T=A(K3+1)
  A(K3+1)=A(K1+1)-T
  A(K1+1)=A(K1+1)+T
  T=A(K1)
  A(K1)=A(K)-T
  A(K)=A(K)+T
  T=A(K1+1)
  A(K1+1)=A(K+1)-T
  A(K+1)=A(K+1)+T
  R=-A(K3+1)
  T = A(K3)
  A(K3)=A(K2)-R
  A(K2)=A(K2)+R
  A(K3+1)=A(K2+1)-T
80 A(K2+1)=A(K2+1)+T
  IF (JLAST) 235,235,82
82 JJ=JJDIF      +1
  ILAST= IL +JJ
  DO 85 I = JJ,ILAST,1DIF
  KLAST = KL+I
  DO 85 K=I,KLAST,2
  K1 = K+KBIT
  K2 = K1+KBIT
  K3 = K2+KBIT
  R =-A(K2+1)
  T = A(K2)
  A(K2) = A(K)-R
  A(K) = A(K)+R
  A(K2+1)=A(K+1)-T
  A(K+1)=A(K+1)+T
  AWR=A(K1)-A(K1+1)
  AWI = A(K1+1)+A(K1)
  R=-A(K3)-A(K3+1)
  T=A(K3)-A(K3+1)
  A(K3)=(AWR-R)/RCOT2
  A(K3+1)=(AWI-T)/RCOT2
  A(K1)=(AWR+R)/RCOT2
  A(K1+1)=(AWI+T)/RCOT2
  T= A(K1)

```

```

A(K1)=A(K)-T
A(K)=A(K)+T
T=A(K1+1)
A(K1+1)=A(K+1)-T
A(K+1)=A(K+1)+T
R=-A(K3+1)
T=A(K3)
A(K3)=A(K2)-R
A(K2)=A(K2)+R
A(K3+1)=A(K2+1)-T
85 A(K2+1)=A(K2+1)+T
IF(JLAST-1) 235,235,90
90 JJ= JJ + JJDEF
DO 230 J=2,JLAST
96 I=INV(J+1)
98 IC=NT-I
W(1)=S(IC)
W(2)=S(I)
I2=2*I
I2C=NT-I2
IF(I2C)120,110,100
100 W2(1)=S(I2C)
W2(2)=S(I2)
GO TO 130
110 W2(1)=0.
W2(2)=1.
GO TO 130
120 I2CC = I2C+NT
I2C=-I2C
W2(1)=-S(I2C)
W2(2)=S(I2CC)
130 I3=I+I2
I3C=NT-I3
IF(I3C)160,150,140
140 W3(1)=S(I3C)
W3(2)=S(I3)
GO TO 200
150 W3(1)=0.
W3(2)=1.
GO TO 200
160 I3CC=I3C+NT
IF(I3CC)190,180,170
170 I3C=-I3C
W3(1)=-S(I3C)
W3(2)=S(I3CC)
GO TO 200
180 W3(1)=-1.
W3(2)=0.
GO TO 200
190 I3CCC=NT+I3CC
I3CC = -I3CC
W3(1)=-S(I3CCC)
W3(2)=-S(I3CC)
200 ILAST=IL+JJ

```

```

DO 220 I=JJ,I LAST, IDIF
KLAST=KL+I
DO 220 K=I,KLAST,2
K1=K+KBIT
K2=K1+KBIT
K3=K2+KBIT
R=A(K2)*W2(1)-A(K2+1)*W2(2)
T=A(K2)*W2(2)+A(K2+1)*W2(1)
A(K2)=A(K)-R
A(K)=A(K)+R
A(K2+1)=A(K+1)-T
A(K+1)=A(K+1)+T
R=A(K3)*W3(1)-A(K3+1)*W3(2)
T=A(K3)*W3(2)+A(K3+1)*W3(1)
AWR=A(K1)*W(1)-A(K1+1)*W(2)
AWI=A(K1)*W(2)+A(K1+1)*W(1)
A(K3)=AWR-R
A(K3+1)=AWI-T
A(K1)=AWR+R
A(K1+1)=AWI+T
T=A(K1)
A(K1)=A(K)-T
A(K)=A(K)+T
T=A(K1+1)
A(K1+1)=A(K+1)-T
A(K+1)=A(K+1)+T
R=-A(K3+1)
T=A(K3)
A(K3)=A(K2)-R
A(K2)=A(K2)+R
A(K3+1)=A(K2+1)-T
220 A(K2+1)=A(K2+1)+T
230 JJ=JJ+DIF+JJ
235 JLAST=4*JLAST+3
240 CONTINUE
250 CCNTINUE
NTSG=NT*NT
M3MT=M3-MT
350 IF(M3MT) 270,360,360
360 IG03=1
N3VNT=N3/NT
MINN3=NT
GO TO 380
370 IG03=2
N3VNT=1
NTVN3=NT/N3
MINN3=N3
380 JJD3 = NTSQ/N3
M2MT=M2-MT
450 IF (M2MT) 470,460,460

```

```

460 IGO2=1
N2VNT=N2/NT
MINN2=NT
GO TO 480
470 IGO2 = 2
N2VNT=1
NTVN2=NT/N2
MINN2=N2
480 JJD2=NTSC/N2
M1MT=M1-MT
550 IF(M1MT)570,560,560
560 IGO1=1
N1VNT=N1/NT
MINN1=NT
GO TO 580
570 IGO1=2
N1VNT=1
NTVN1=NT/N1
MINN1=N1
580 JJD1=NTSQ/N1
600 JJ3=1
J=1
DC 880 JPP3=1,N3VNT
IPP3=INV(JJ3)
DO 870 JP3=1,MINN3
GO TO (610,620),IGO3
610 IP3=INV(JP3)*N3VNT
GO TO 630
620 IP3=INV(JP3)/NTVN3
630 I3=(IPP3+IP3)*N2
700 JJ2=1
DO 870 JPP2=1,N2VNT
IPP2=INV(JJ2)+I3
DO 860 JP2=1,MINN2
GO TO (710,720),IGO2
710 IP2=INV(JP2)*N2VNT
GO TO 730
720 IP2=INV(JP2)/NTVN2
730 I2=(IPP2+IP2)*N1
800 JJ1=1
DO 860 JPP1=1,N1VNT
IPP1=INV(JJ1)+I2
DO 850 JP1=1,MINN1
GO TO (810,820),IGO1
810 IP1=INV(JP1)*N1VNT
GO TO 830
820 IP1=INV(JP1)/NTVN1
830 I=2*(IPP1+IP1)+1
IF (J-I) E40,E50,E50
840 T=A(I)
A(I)=A(J)
A(J)=T
T=A(I+1)
A(I+1)=A(J+1)
A(J+1)=T
850 J=J+2
860 JJ1=JJ1+JJD1
870 JJ2=JJ2+JJD2
880 JJ3 = JJ3+JJD3
890 IF(IFSET)891,895,E95

```

```

891 DO 892 I = 1,NX
892 A(2*I) = -A(2*I)
895 RETURN
900 MT=MAX0(M(1),M(2),M(3)) -2
      MT = MAX0(2,MT)
904 IF (MT-18) 906,906,13
906 IFERR=0
      NT=2**MT
      NTV2=NT/2
910 THETA=.7853981E34
      JSTEP=NT
      JDIF=NTV2
      S(JDIF)=SIN(THETA)
      DO 950 L=2,MT
      THETA=THETA/2.
      JSTEP2=JSTEP
      JSTEP=JDIF
      JDIF=JSTEP/2
      S(JDIF)=SIN(THETA)
      JC1=NT-JDIF
      S(JC1)=COS(THETA)
      JLAST=NT-JSTEP2
      IF(JLAST - JSTEP) 950,920,920
920 DO 940 J=JSTEP,JLAST,JSTEP
      JC=NT-J
      JD=J+JDIF
940 S(JD)=S(J)*S(JC)+S(JDIF)*S(JC)
950 CONTINUE
960 MTLEXP=NTV2
      LM1EXP=1
      INV(1)=0
      DO 980 L=1,MT
      INV(LM1EXP+1) = MTLEXP
      DO 970 J=2,LM1EXP
      JJ=J+LM1EXP
970 INV(JJ)=INV(J)+MTLEXP
      MTLEXP=MTLEXP/2
980 LM1EXP=LM1EXP*2
982 IF(IFSET)12,895,12
      END

```

## APPENDIX B

```

// EXEC FORT.GCG
//FORTRAN DD *,DCB=RLKSIZE=3440
C AREL1
C SENSITIVITY STUDY IS AVAILABLE
C DELTA K THRESHOLD IS AVAILABLE
C THREE LOADS (COMPOSIT OR SINGLE GAUSSIAN) ARE AVAILABLE
    DIMENSION AA(10),AAA(10),BAB(10)
    DIMENSION A(1501),R(1501),H(1501),TH(1501),N(1501)
    DIMENSION PP(3),SGC(3),ZR(3),ANETA(3)
    DIMENSION DUMY(1501),TP(50),P(50),PS(50),RK(50),CIJ(50),QIJ(50)
    DIMENSION CMP(3),SGS(3),VX(3),AN(3),UPC(3),SB(3)
    DIMENSION AAAA(13)

81 CONTINUE
C MEAN VALUES
C FRACTURE DATA
C
EE=2.5
BE=4.0
DKTH=1.5
EFD=10.0
C=3.0E-7
KC=60.0
C INITIAL CRACK DATA
AA=0.04
ALPHA=4.0
BETA=30000.0
C LOAD DATA
C C1P (1.0=COMPOSIT GAUSSIAN, 0.0=SINGLE ONE)
    CMP(1)=1.0
    CMP(2)=1.0
    CMP(3)=1.0
C UPC (1.0=UPPER CUT SINGLE GAUSSIAN, 0.0=COMPLETE ONE)
    UPC(1)=0.0
    UPC(2)=0.0
    UPC(3)=0.0
C EL=UPPER CUT LEVEL (EL*X0)
    EL=8.0
    G=10.0
    AA(4)=115.0
    AAA(4)=115.0
    AAAA(4)=80.0
    BAB(4)=3.0
C AN(I) NUMBER OF LOAD CYCLES PER HOUR
    AN(1)=600.0
    AN(2)=600.0
    AN(3)=60.0
    ANA=0.5
    PP(1)=0.4975
    PP(2)=0.0025
    PP(3)=0.5
C SGC STANDARD DEVIATION OF COMPOSITE GAUSSIAN
    SGC(1)=0.07*G
    SGC(2)=0.18*G
    SGC(3)=0.1*G
C SGS STANDARD DEVIATIONS (SINGLE GAUSSIAN)
    SGS(1)=1.5*G
    SGS(2)=1.5*G
    SGS(3)=1.5*G
    X0=1.0*G
    ZR=1.5

```

```

C * MATERIAL DATA
V0=0.056
AMJO=5.7*G
P0=5.7*G
C * FAI SAFETY DATA
FSF=1.0
ZETA=0.43
AS=7.0
C * TOTAL FLIGHT HOUR
TT=15000.0
C * INSPECTION DATA
A1=0.02
A2=0.3
RM=0.125
U=1.0
C * NUMBER OF INSPECTIONS
C TT/(NN+1) MUST BE INTEGER
C (TT/(NN+1))/(TT/(NPT-1)) MUST BE INTEGER
NN=0
C PI=3.14159
C NPT BASIC DATA POINTS
C EACH DIMENSION SIZE OF(A,R,H,TH,DUMY,N)MUST BE G.E. NPT
C (TT/(NPT-1)) MUST BE INTEGER
NPT=1501
C NOI DATA POINTS UNDER NO INSPECTION CASE
C EACH DIMENSION SIZE OF(TP P,PS,PK,CIJ,QIJ)MUST BE G.E. NOI AND (NN+1)
C (TT/NOI)/(TT/(NPT-1)) MUST BE INTEGER
NOI=30
C FLEET SIZE
NF=50
C SUB PROGRAM FOR SENSITIVITY STUDY
READ(5,501) XY,YZ1,YZ2,YZ3
501 FORMAT(4F10.0)
WRITE(6,650) XY,YZ1,YZ2,YZ3
650 FORMAT(1H,///,XY,YZ1,YZ2,YZ3!,4E15.7)
IF(XY.LE.0.0) GO TO 322
IF(XY.EQ.1.0) EF=YZ1
IF(XY.EQ.2.0) DKTH=YZ1
IF(XY.EQ.3.0) EF=YZ1
IF(XY.EQ.4.0) C=YZ1
IF(XY.EQ.5.0) AD=YZ1
IF(XY.EQ.6.0) AND=YZ1
IF(XY.EQ.7.0) AVA=YZ1
IF(XY.EQ.8.0) ANM=YZ1
IF(XY.EQ.9.0) VO=YZ1
IF(XY.EQ.10.0) ZETA=YZ1
IF(XY.EQ.11.0) AS=YZ1
IF(XY.EQ.12.0) KC=IFIX(YZ1)
IF(XY.NE.13.0) GO TO 721
PP(1)=YZ1
PP(2)=YZ2
PP(3)=YZ3
721 CONTINUE
IF(XY.NE.14.0) GO TO 722
SGC(1)=YZ1

```

```

SGC(2)=YZ2
SGC(3)=YZ3
722 CONTINUE
IF(XY.NE.15.0) GO TO 723
G=YZ1
SGC(1)=0.07*G
SGC(2)=0.18*G
SGC(3)=0.1*G
X0=1.0*G
R0=5.7*G
AMU0=5.7*G
723 CONTINUE
IF(XY.NE.16.0) GO TO 724
AMU0=YZ1
R0=YZ1
724 CONTINUE
IF(XY.EQ.17.0) A_PHA=YZ1
IF(XY.EQ.18.0) BETA=YZ1
IF(XY.EQ.19.0) FSF=YZ1
IF(XY.EQ.20.0) BE=YZ1
IF(XY.EQ.21.0) AA(4)=YZ1
IF(XY.EQ.21.0) AAAA(4)=YZ1
IF(XY.EQ.22.0) AAAA(4)=YZ1
IF(XY.EQ.23.0) ZR=YZ1
IF(XY.NE.24.0) GO TO 725
SGS(1)=YZ1
SGS(2)=YZ2
SGS(3)=YZ3
725 CONTINUE
IF(XY.NE.25.0) GO TO 726
CMP(1)=YZ1
CMP(2)=YZ2
CMP(3)=YZ3
725 CONTINUE
IF(XY.EQ.26.0) A1=YZ1
IF(XY.EQ.27.0) A2=YZ1
IF(XY.EQ.28.0) RM=YZ1
IF(XY.EQ.29.0) U=YZ1
IF(XY.EQ.30.0) VV=YZ1
IF(XY.NE.31.0) GO TO 727
UPC(1)=YZ1
UPC(2)=YZ2
UPC(3)=YZ3
727 CONTINUE
IF(XY.EQ.32.0) EL=YZ1
C SJ3 PROGRAM FOR SENSITIVITY STUDY ***END
C JKL=0
KBE=BE
IBF=BE
IF(CMP(1).EQ.1.0) SB(1)=AA(IBF)*BAB(IBF)*SGC(1)**KBE
IF(CMP(1).EQ.0.0) SB(1)=AA(IBF)*BAB(IBF)*SGS(1)**KBE
IF(CMP(2).EQ.1.0) SB(2)=AAA(IBF)*BAB(IBF)*SGC(2)**KBE
IF(CMP(2).EQ.0.0) SB(2)=AAA(IBF)*BAB(IBF)*SGS(2)**KBE
IF(CMP(3).EQ.1.0) SB(3)=AAAA(IBF)*BAB(IBF)*SGC(3)**KBE
IF(CMP(3).EQ.0.0) SB(3)=AAAA(IBF)*BAB(IBF)*SGS(3)**KBE
ZBB=(ZR*G)**KBE
Q=AN(1)*PP(1)*SB(1)+AN(2)*PP(2)*SB(2)+AN(3)*PP(3)*SB(3)
1+AN(1)*ZBB
AC=2./PI*(KC/RD)**2

```

```

DT=TT/FLOAT(NPT-1)
C
ANS=PP(1)*AN(1)+PP(2)*AN(2)+PP(3)*AN(3)
C ANS=CYCLES PER HOUR
C $$$ THRESHOLD WO IREJA A(I) NO KEISAN $$$
TF(EF.EQ.2.0) FFE=2.01
TF(FFD.EQ.2.0) FFD=2.01
C
ANTH=ALOG10(CJ+EE*ALOG10(DKTH))
C
CDST=ANTH-EFD*ALOG10(DKTH)
CDS=10.0**CDST
C
ATH=(DKTH/(Q/ANS)**(1.0/3E))**2/(2.0/PI)
C
TB=2.0/(2.0-EFD)/CDS*0.8*(EFD/BE)*ANS**((EFD-BE)/BE)
TB=TB/(PI/2.0)**(EFD/2.0)
TB=TB*((ATH**((2.0-EFD)/2.0)-AO)**((2.0-EFD)/2.0))
C
DO 8 I=1,NPT
T=FLOAT(I-1)*DT
IF(TB.GT.0.0) GO TO 43
C IN CASE OF ATH.LT.AO
A(I)=AO**((2.0-EF)/2.0)
A(I)=A(I)+((2.0-EF)/2.0)*CDS*Q**((EF/BE)*ANS**((BE-EF)/BE))
1 *(PI/2.0)**(EF/2.0)
IF(A(I).LT.0.00001) GO TO 45
A(I)=A(I)**(2.0/(2.0-EF))
GO TO 48
43 CONTINUE
C IN CASE OF ATH.GT.AO
IF(T.GT.TB) GO TO 49
A(I)=AO**((2.0-EFD)/2.0)
A(I)=A(I)+((2.0-EFD)/2.0)*CDS*Q**((EFD/BE)*ANS**((BE-EFD)/BE))
1 *(PI/2.0)**(EFD/2.0)
IF(A(I).LT.0.00001) GO TO 45
A(I)=A(I)**(2.0/(2.0-EFD))
C
GO TO 48
C
49 A(I)=ATH**((2.0-EF)/2.0)
A(I)=A(I)+((2.0-EF)/2.0)*CDS*Q**((EF/BE)*ANS**((BE-EF)/BE)*(T-TB))
1 *(PI/2.0)**(EF/2.0)
IF(A(I).LT.0.00001) GO TO 45
A(I)=A(I)**(2.0/(2.0-EF))
GO TO 48
45 A(I)=10000.0
C
48 IF(ESE.EQ.0.0) AS=1000.0
IF(ABS(A(I)).GT.AS) GO TO 15
8 CONTINUE
GO TO 46
15 KK=I
DO 60 I=KK,NPT
50 A(I)=AS
46 CONTINUE
C #44 A(I)=CAL END #44
IF(ATH.GT.AC) GO TO 353
TC=2.0/(2.0-EF)**(AC**((2.0-EF)/2.0)-ATH**((2.0-EF)/2.0))
TC=TC/C/Q**((EF/BE)*ANS**((BE-EF)/BE)/(PI/2.0)**(EF/2.0))

```

```

TC=TC+TB
GO TO 364
363 TC=2.0/(2.0-EFD)**(AC**((2.0-EFD)/2.0)-AO**((2.0-EFD)/2.0))
      TC=TC/CDS/3**((FF)/BE)/ANS**((3E-EFD)/BE)/(PI/2.0)**(EF/2.0)
364 WRITE(6,800) SB(1),CMP(1),SB(2),CMP(2),SB(3),CMP(3),ZBB,Q,ANS
800 FORMAT(1H ,/, SB1,SB2,SB3,ZBB,Q,ANS ',,,
13(E12.4,'(,F4.1,')),3E12.4)
      WRITE(6,801) ATH,TB,AC,TC,CDS,FSF
801 FORMAT(1H ,/, 'ATH,TB,AC,TC,DS,FSF',/,5E12.4)
C
C RESIDUAL STRENGTH RATE ( FSF=1.0(FAIL SAFE) =0.0(NO FAIL SAFE) )
DO 18 I=1,NPT
IF(FSF.EQ.1.0) G7 TO 189
IF(A(I).LE.AC) G7 TO 189
R(I)=FLOAT(KC)*SQRT(2.0/PI/A(I))/20
GO TO 18
188 R(I)=1.0
G7 TO 18
139 SW=ABS((A(I)-AO)/(AS-AO))
R(I)=1.0-(1.0-ZETA)*SQRT(SW)
18 CONTINUE
C
C $$$ CAL. OF H $$$
DO 115 N=1,NPT
HWA=0.0
GMN=R(N)
DO 116 I=1,3
IF(CMP(I).EQ.0.0) SGC(I)=SGS(I)
VX(I)=SGC(I)/X0
ANETA(I)=GMN*AMU0/SGC(I)-X0/SGC(I)
RR(I)=V0*GMN*AMU0/SGC(I)
ARG0=ANETA(I)/SQRT(2.0)/RR(I)
ARG1=-ANETA(I)+RR(I)**2/2.0
ARG2=(ANETA(I)-RR(I)**2)/SQRT(2.0)/RR(I)
ARG3=ANETA(I)/RR(I)/SQRT(2.0)
ARG4=1.0/SQRT(1.0+RR(I)**2)
ARG5=-0.5*(1.0/VX(I)**2+1.0/V0**2)
ARG6=0.5*(RR(I)/VX(I)+1.0/V0)**2/(1.0+RR(I)**2)
ARG7=ANETA(I)/SQRT(2.0)/RR(I)/SQRT(1.0+RR(I)**2)
ARG8=1.0/SQRT(2.0)/SQRT(RR(I)**2+1.0)
1*((FI-1.0)*RR(I)/VX(I)+FL/RR(I)/VX(I)-1.0/V0)
IF(CMP(I).EQ.1.0) CALL HCOM(H(N),ARG0,ARG1,ARG2,ARG3,ARG4,
1ARG5,ARG6,ARG7,ARG8,PP(I),AN(I))
IF(CMP(I).EQ.0.0) CALL HSIN(H(N),ARG0,ARG1,ARG2,ARG3,ARG4,
1ARG5,ARG6,ARG7,ARG8,PP(I),AN(I),UPC(I))
HWA=HWA+H(N)
115 CONTINUE
H(N)=HWA
IF(H(N).GT.1.0) H(N)=1.0
115 CONTINUE
C ### CAL. OF H END ###
CALL QSF(DT,H,TH,NPT)
ALPH1=ALPHA-1
DO 208 T=1,NPT
T=FLOAT(I-1)*DT
TBETA=T/BETA
203 W(I)=ALPHA/BETA*T*BETA**ALPH1*EXP(-T*BETA**ALPHA)
      WRITE(6,1010)
1010 FORMAT(1H ,/, I,TIME,A,R,H,TH,W',/)
C**IF NEED MORE ACCURATE PJT: DO 80 I=1,NPT,BIGGER

```

```

      DD 80 I=1,NPT,50
      T=FLOAT(I-1)*DT
      WRITE(6,1020) T,T,A(I),R(I),H(I),TH(I),N(I)
1020 FORMAT(1H ,I4,F8.1,2F11.4,3F13.3)
      80 CONTINUE
      WRITE(6,600) NN
      600 FORMAT(1H ,'NN=' ,I5)
      DD 77 I=1,NPT
      DUMY(I)=H(I)
      77 CONTINUE
      H0=DUMY(1)

```

C IF(NN.NE.0) GO TO 100  
 C INSPECTION CASE

```

      NN=NPT-1
      TI=TT*FLOAT(NN+1)
      NDT=TI/DT

```

```

      NNN=NN+1
      DD 10 I=1,NNN
      TTO=TI*FLOAT(I)
      IT=NDT*I+1

```

```

      DD 20 K=1,IT
      T=FLOAT(K-1)*DT

```

```

      NH=IT+1-K

```

```

      X=-T*HO-TH(NH)

```

```

      FX=EEXP(X)

```

```

      DUMY(K)=W(K)+W(K)*FX

```

```

      20 CONTINUE

```

```

      CALL QSF(DT,DUMY,DUMY,IT)

```

```

      X=-TTO*HO-(TTO/BETA)*ALPHA

```

```

      XX=EEXP(X)

```

```

      P(I)=-XX-DUMY(IT)

```

```

      IF(P(I).LT.1.0E-20) P(I)=1.0E-20

```

```

      WRITE(6,688) I,IT,TTO,X,XX,DUMY(IT),P(I)

```

```

      688 FORMAT(1H ,I3,I6,F10.1,4E15.7)

```

```

      10 CONTINUE

```

```

      GO TO 3000

```

C INSPECTION CASE

```

      100 CONTINUE

```

```

      NNN=NN+1

```

```

      TI=TT*FLOAT(NN+1)

```

```

      NDT=TI/DT

```

```

      IT=NDT+1

```

```

      DD 2000 J=1,NNN

```

```

      TTO=TI*FLOAT(J)

```

C \*PS(J) \*

```

      DD 200 K=1,IT

```

```

      T=DT*FLOAT(K-1)

```

```

      NH=IT+1-K

```

```

      NW=(J-1)*NDT+K

```

```

      X=-(T*FLOAT(J-1)*TI)*HO-TH(NH)

```

```

      FX=EEXP(X)

```

```

      DUMY(K)=W(NW)+W(NW)*FX

```

```

      200 CONTINUE

```

```

      CALL QSF(DT,DUMY,DUMY,IT)

```

```

      X=-(FLOAT(J-1)*TI)/BETA*ALPHA

```

```

      Y=-(FLOAT(JJ)*TI/BETA)*ALPHA-FLOAT(J)*TI*HO

```

```

      EX=EEXP(X)

```

```

      FY=EEXP(Y)

```

```

      PS(J)=EX-FY-DUMY(IT)

```

```

IF(J.NE.1) GO TO 210
P(J)=PS(J)
GO TO 220
210 CONTINUE
C *** TERM 1 ***
WRITE(6,1009)
1009 FORMAT(1H ,3X,'QIJ(I)=')
JM=J-1
DO 1000 I=1, JM
DO 250 K=1, IT
T=DT*FLOAT(K-1)
NW=(I-I)*NDT+K
ZZ=-H0*(FLOAT(I-1)*IT+I)
C *** TERM 1 ***
NA=IT+1-K
NH=NA
NK=J-I
X=ZZ-TH(NH)-RK(NC)
EX=EEXP(X)
AX=A(NA)
TERM1=-F(AX,A1,A2,RM,J)*EX
C *** TERM 2 ***
FSM=1.0
JII=J-I
DO 350 KK=1, JII
NA=KK*NDT+2-K
AX=A(NA)
350 FSM=FSM*(1.0-F(AX,A1,A2,RM,U))
NH=(J-I+1)*NDT+2-K
X=ZZ-TH(NH)
EX=EFXP(X)
TERM2=-FSM*EX
C *** TERM 3 ***
TERM3=0.0
II=J-I
IF(II.LT.2) GO TO 480
DO 400 KK=2, II
FSM=1.0
KKM=KK-1
DO 450 M=1, KKM
NA=M*NDT+2-K
AX=A(NA)
X=F(AX,A1,A2,RM,U)
FS=1.0-F(AX,A1,A2,RM,U)
450 FSM=FSM*FS
NA=KK*NDT+2-K
AX=A(NA)
NH=NA
NK=J-I-KK+1
X=ZZ-TH(NH)-RK(NC)
FX=EEXP(X)
400 TERM3=TERM3-FSM*F(AX,A1,A2,RM,U)*EX
430 DUMMY(K)=TERM1+TERM2+TERM3*W(NW)
250 CONTINUE
CALL QSF(DT,DUMMY,DUMMY,IT)
QIJ(I)=DUMMY(IT)
1000 CONTINUE
C
TQIJ=0.0
DO 490 I=1, JM

```

```

490 TQIJ=TQIJ+QIJ(I)
P(J)=PS(J)+TQIJ
I=(P(J).LT.1.0E-20) P(J)=1.0E-20
220 RK(J)=P(J)+P(J)**2/2.0+P(J)**3/3.0
2000 CONTINUE
C
3000 CONTINUE
WRITE(6,593)
59.8 FORMAT(1H ,,' I,T,P(I),TP(I)',/)
DO 321 I=1,NNN
TTO=TI*FLOAT(I)
IF(P(I).GT.0.0001) GO TO 324
TP(I)=FLOAT(NF)*P(I)-FLOAT(NF)*FLOAT(NF-1)*P(I)**2/2.0
GO TO 325
324 IF(P(I).GT.0.9) GO TO 326
TP(I)=1.0-(1.0-P(I))**NF
GO TO 325
325 TP(I)=1.0
326 CONTINUE
WRITE(6,599) I,TTO,P(I),TP(I)
599 FORMAT(1H ,I5,F10.1,2E15.5)
321 CONTINUE
GO TO 81
322 STOP
END
SUBROUTINE FCOM(+,AR0,AR1,AR2,AR3,AR4,AR5,
1AR6,AR7,AR8,P,AN)
C CAL. FOR COMPOSITE GAUSSIAN
H=0.5*AN*PE((1.0-ERF(AR0))+EXP(AR1)*(1.0+ERF(AR2)))
RETURN
END
SUBROUTINE FSIN(+,AR0,AR1,AR2,AR3,AR4,AR5,
1AR6,AR7,AR8,P,AN,UPC)
C CAL. FOR SINGLE GAUSSIAN
IF(UPC.EQ.1.0) GO TO 10
C COMPLETE SINGLE GAUSSIAN
H=0.5*AN*PE((1.0-ERF(AR3))+AR4
1*EXP(AR5+AR6)*(1.0+ERF(AR7)))
GO TO 25
C UPPER CUT SINGLE GAUSSIAN
10 H=0.5*AN*PE((1.0-ERF(AR3))+AR4
1*EXP(AR5+AR6)*(ERF(AR7)+ERF(AR8)))
25 RETURN
END
FUNCTION EEXP(ARG)
A=0.01
B=-50.0
C=1.0E-20
IF(ABS(ARG).LT.C) GO TO 5
IF(ABS(ARG).LT.A) GO TO 10
IF(ARG.LT.B) GO TO 30
EEXP=EXP(ARG)-1.0
GO TO 20
5 EEXP=ARG
GO TO 20
10 EEXP=ARG+ARG*ARG/2.0+ARG*ARG*ARG/6.0
GO TO 20
30 EEXP=-1.0
20 CONTINUE
RETURN

```

```

END
FUNCTION F(X,A1,A2,RM,U)
IF(X.LT.A1) GO TO 10
IF(X.GT.A2) GO TO 20
F=((X-A1)/(A2-A1))*RM
GO TO 1
10 F=0.0
GO TO 1
20 F=1.0
1 CONTINUE
F=U+F
RETURN
END
FUNCTION FS(X)
FS=1.0-F(X)
RETURN
END
FUNCTION ERF(X)
IF(ABS(X).GT.10.0) GO TO 3
X=X*1.414214
T=1.0/(1.0+2316419*ABS(X))
D=0.398942*EXP(-X*X/2.0)
ERF=2.*((0.5-D*T)*(((1.33274*T-1.821255)*T+1.731473)*T
1-0.356563)*T+0.319381)
IF(X) 1,2,2
1 ERF=-ERF
GO TO 2
3 ERF=1.0
IF(X.LT.0.0) ERF=-ERF
2 RETURN
END
SUBROUTINE QSF(H,Y,Z,NDIM)
C
C DIMENSION Y(1),Z(1)
C
HT=.3333333*H
IF(NDIM-5)7,8,1
C
C NDIM IS GREATER THAN 5. PREPARATIONS OF INTEGRATION LOOP
1 SUM1=Y(2)+Y(2)
SUM1=SUM1+SUM1
SUM1=HT*(Y(1)+SUM1+Y(3))
AUX1=Y(4)+Y(4)
AUX1=AUX1+AUX1
AUX1=SUM1+HT*(Y(3)+AUX1+Y(5))
AUX2=HT*(Y(1)+3.875*(Y(2)+Y(5))+2.625*(Y(3)+Y(4))+Y(6))
SUM2=Y(5)+Y(5)
SUM2=SUM2+SUM2
SUM2=AUX2-HT*(Y(4)+SUM2+Y(5))
Z(1)=0.
AUX=Y(3)+Y(3)
AUX=AUX+AUX
Z(2)=SUM2-HT*(Y(2)+AUX+Y(4))
Z(3)=SUM1
Z(4)=SUM2
IF(NDIM-6)5,5,2
C
C INTEGRATION LOOP
2 DO 4 I=7,NDIM,2

```

```

SUM1=AUX1
SUM2=AUX2
AUX1=Y(I-1)+Y(I-1)
AUX1=AUX1+AUX1
AUX1=SUM1+HT*(Y(I-2)+AUX1+Y(I))
Z(I-2)=SUM1
IF(I-NDIM)3,6,6
3 AUX2=Y(I)+Y(I)
AUX2=AUX2+AUX2
AUX2=SUM2+HT*(Y(I-1)+AUX2+Y(I+1))
4 Z(I-1)=SUM2
5 Z(NDIM-1)=AUX1
Z(NDIM)=AUX2
RETURN
6 Z(NDIM-1)=SUM2
Z(NDIM)=AUX1
RETURN
C END OF INTEGRATION LOOP
C
7 IF(NDIM-3)12,11,8
C
C NDIM IS EQUAL TO 4 OR 5
8 SUM2=1.125*HT*(Y(1)+Y(2)+Y(2)+Y(3)+Y(3)+Y(3)+Y(4))
SUM1=Y(2)+Y(2)
SUM1=SUM1+SUM1
SUM1=HT*(Y(1)+SUM1+Y(3))
Z(1)=0
AUX1=Y(3)+Y(3)
AUX1=AUX1+AUX1
Z(2)=SUM2-HT*(Y(2)+AJX1+Y(4))
IF(NDIM-5)10,9,9
9 AJX1=Y(4)+Y(4)
AUX1=AUX1+AUX1
Z(5)=SUM1+HT*(Y(3)+AJX1+Y(5))
10 Z(3)=SUM1
Z(4)=SUM2
RETURN
C
C NDIM IS EQUAL TO 3
11 SUM1=HT*(1.25*Y(1)+Y(2)+Y(2)-.25*Y(3))
SUM2=Y(2)+Y(2)
SUM2=SUM2+SUM2
Z(3)=HT*(Y(1)+SUM2+Y(3))
Z(1)=0
Z(2)=SUM1
12 RETURN
END
//GD.SYSIN DD *
123.0
-123.0
/*

```

## APPENDIX C

```
// EXEC FORTHCG  
// FORT.SYSIN DD *,DCB=BLKSIZE=3440  
C AREL2  
C SENSITIVITY STUDY IS AVAILABLE  
C DELTA-K THRESHOLD IS AVAILABLE  
C TREF LOADS (COMPOSIT OR SINGLE GAUSSIAN) ARE AVAILABLE  
C ANY TOTAL FLIGHT HOUR IS AVAILABLE  
DIMENSION AA(10),AAA(10),BAB(10)  
DIMENSION AAAA(10)  
DIMENSION A(1501),R(1501),H(1501),TH(1501)  
DIMENSION PP(3),SGC(3),RR(3),ANETA(3)  
DIMENSION CMP(3),SGS(3),VX(3),AN(3),UPC(3),SB(3)  
DIMENSION J(126),GA(126,15),GTH(126,15),ITD(15)  
DIMENSION GME(125)  
COMMON A1,A2,RM,U,NT,NPT,DA,NE,PME  
COMMON/QWE/ ALPHA,BETA,EFD,CDS,3,ANS,BE  
COMMON/PDI/ CA1,NC,NR  
31 CONTINUE  
C MEAN VALVES *  
C FRACTURE DATA  
FF=2.5  
BE=4.0  
DKTH=1.5  
EFD=10.0  
C=3.0E-7  
KC=60  
C INITIAL CRACK DATA  
NB_N=125  
AO=0.04  
AU=AO  
AL=0.015  
ALPHA=4.0  
BETA=30000.0  
C LOAD DATA  
C CMP (=1.0 COMPOSIT GAUSSIAN ,=0.0 SINGLE ONE)  
CMP(1)=1.0  
CMP(2)=1.0  
CMP(3)=1.0  
C UPC (=1.0 UPPER CUT SINGLE GAUSSIAN ,=0.0 COMPLETE ONE)  
UPC(1)=0.0  
UPC(2)=0.0  
UPC(3)=0.0  
C EL UPPER CUT LEVEL OF SINGLE GAUSSIAN (EL*X0)  
EL=8.0  
G=10.0  
AA(4)=115.0  
AAA(4)=115.0  
AAA(4)=80.0  
BAB(4)=3.0  
C AN(I) NUMBER OF LOAD CYCLES PER HOUR  
AN(1)=600.0  
AN(2)=600.0  
AN(3)=60.0  
ANA=0.5  
PP(1)=0.4975  
PP(2)=0.0925  
PP(3)=0.5  
C SGC STANDARD DEVIATION OF COMPOSITE GAUSSIAN  
SGC(1)=0.07*G
```

```

SGS(2)=0.18*G
SGS(3)=0.1*G
C SGS STANDARD DEVIATION OF SINGLE GAUSSIAN
SGS(1)=1.5*G
SGS(2)=1.5*G
SGS(3)=1.5*G
X0=1.0*G
ZR=1.5
C MATERIAL DATA
VO=0.056
AMU0=5.7*G
R0=5.7*G
C FAULT-SAFE DATA
FSF=1.0
ZETA=0.43
AS=7.0
C TT TOTAL FLIGHT HOUR
TT=15000.0
C INSPECTION DATA
A1=0.02
A2=0.3
RM=0.125
U=1.0
C NN NUMBER OF INSPECTIONS
C TT/(NN+1) MUST BE INTEGER
C (TT/(NN+1))/(TT/(NPT-1)) MUST BE INTEGER
NN=5
C I= # OF INSPEC. GT. 5 GA( ,6), GTH( ,6), ITD(6) MUST BE CHANGED
C # OF INSPEC.=NN GA( ,NN+1), GTH( ,NN+1), ITD(NN+1)
C PROOF TEST DATA
ACT=999.0
C ACT CUT-LEVEL OF INT. CRACK DISTRIBUTION
C ACT.GT.AU MEANS NO PROOF TEST PERFORMED
C CURSORY INSPEC. DATA
CSR=Y=0.0
NR=1
NC=4
CA1=0.6
PI=3.14159
C NPT BASIC DATA POINTS
C EACH DIMENSION SIZE OF(A,R,H,TH,DUMY,W)MUST BE G.E. NPT
C (TT/(NPT-1))-MUST BE INTEGER
NPT=1501
C NOI DATA POINTS UNDER NO INSPECTION CASE
C EACH DIMENSION SIZE OF(TP P,PS,RK,CIJ,CIJ)MUST BE G.E. NOI AND (NN+1)
C (TT/NOI)-(TT/(NPT-1)) MUST BE INTEGER
NOI=30
C FLEET SIZE
NF=50
C SJB PROGRAM FOR SENSITIVITY STUDY
RFAD(5,501) XY,YZ1,YZ2,YZ3
501 FORMAT(4F10.0)
WRITE(6,650) XY,YZ1,YZ2,YZ3

```

```

650 FORMAT(1H , //, XY,YZ1,YZ2,YZ3,4F15.7)
IF(XY.LE.0.0) GO TO 322
IF(XY.EQ.1.0) EF=YZ1
IF(XY.EQ.2.0) DKTH=YZ1
IF(XY.EQ.3.0) EFD=YZ1
IF(XY.EQ.4.0) C=YZ1
IF(XY.EQ.5.0) AO=YZ1
IF(XY.EQ.5.0) AU=YZ1
IF(XY.EQ.6.0) AN(1)=YZ1
IF(XY.EQ.6.0) AN(2)=YZ1
IF(XY.EQ.7.0) ANA=YZ1
IF(XY.EQ.8.0) AN(3)=YZ1
IF(XY.EQ.9.0) VO=YZ1
IF(XY.EQ.10.0) ZETA=YZ1
IF(XY.EQ.11.0) AS=YZ1
IF(XY.EQ.12.0) KC=YZ1
IF(XY.NE.13.0) GO TO 721
PP(1)=YZ1
PP(2)=YZ2
PP(3)=YZ3
721 CONTINUE
IF(XY.NE.14.0) GO TO 722
SGC(1)=YZ1
SGC(2)=YZ2
SGC(3)=YZ3
722 CONTINUE
IF(XY.NE.15.0) GO TO 723
G=YZ1
SGC(1)=0.07*G
SGC(2)=0.18*G
SGC(3)=0.1*G
X0=1.0*G
R0=5.7*G
AMU0=5.7*G
723 CONTINUE
IF(XY.NE.16.0) GO TO 724
AMU0=YZ1
R0=YZ1
724 CONTINUE
IF(XY.EQ.17.0) ALPHA=YZ1
IF(XY.EQ.18.0) BETA=YZ1
IF(XY.EQ.19.0) FSF=YZ1
IF(XY.EQ.20.0) BE=YZ1
IF(XY.EQ.21.0) A1(4)=YZ1
IF(XY.EQ.21.0) AAA(4)=YZ1
IF(XY.EQ.22.0) AAAA(4)=YZ1
IF(XY.EQ.23.0) ZR=YZ1
IF(XY.NE.24.0) GO TO 725
SGS(1)=YZ1
SGS(2)=YZ2
SGS(3)=YZ3
725 CONTINUE
IF(XY.NE.25.0) GO TO 726
CMP(1)=YZ1
CMP(2)=YZ2
CMP(3)=YZ3
726 CONTINUE
IF(XY.EQ.26.0) A1=YZ1
IF(XY.EQ.27.0) A2=YZ1
IF(XY.EQ.28.0) RM=YZ1

```

```

IF(XY.EQ.29.0) U=YZ1
IF(XY.EQ.30.0) NN=YZ1
IF(XY.NE.31.0) GO TO 727
UPC(1)=YZ1
UPC(2)=YZ2
UPC(3)=YZ3
727 CONTINUE
IF(XY.EQ.32.0) EL=YZ1
IF(XY.EQ.33.0) AC=T=YZ1
IF(XY.EQ.34.0) CA1=YZ1
C SJ3 PROGRAM FOR SENSITIVITY STUDY END
C
JKL=0
KBE=BE
IBE=BE
IF(CMP(1).EQ.1.0) SB(1)=AA(TBE)*3 AB(IBE)*SGC(1)*KBE
IF(CMP(1).EQ.0.0) SB(1)=AA(IBE)*SGS(1)*KBE
IF(CMP(2).EQ.1.0) SB(2)=AAA(IBE)*BAB(IBE)*SGC(2)*KBE
IF(CMP(2).EQ.0.0) SB(2)=AAA(IBE)*SGS(2)*KBE
IF(CMP(3).EQ.0.0) SB(3)=AAAA(IBE)*SGS(3)*KBE
IF(CMP(3).EQ.1.0) SB(3)=AAAA(IBE)*BAB(IBE)*SGC(3)*KBE
ZBB=(ZR*G)*KBE
Q=AN(1)*PP(1)*SB(1)+AN(2)*PP(2)*SB(2)+AN(3)*PP(3)*SB(3)
1+ANA*ZBB
AC=2./PI*(KC/R0)*#2
DT=TT/FLOAT(NPT-1)
ANS=PP(1)*AN(1)+PP(2)*AN(2)+PP(3)*AN(3)
C ANS=CYCLES PER HOUR
C
IF(EF.EQ.2.0) EF=2.01
IF(EFD.EQ.2.0) EFD=2.01
C
ANTH=ALOG10(C)+EF*ALOG10(DKTH)
C
CDST=ANTH-EFD*ALOG10(DKTH)
CDS=10.0*CDST
C
IF(CSRY.EQ.1.0) NN=NR+(NR+1)*NC
IF(NN.EQ.0) GO TO 24
NN1=NN+1
DO 20 I=1,NN1
20 ITD(I)=I*(NPT-1)/(NN+1)+1
GO TO 22
24 CONTINUE
DO 23 I=1,6
23 ITD(I)=I*(NPT-1)/6+1
NN1=6
22 CONTINUE
NBN1=NBN+1
NT=NBN1
CALL DENST(0,NT,AU,AL,DA)
IF(ACT.GT.AU) PMF=1.0
IF(ACT.GT.AU) GO TO 830
NTC=(AU-ACT)/DA
NTT=NT-NTC
DO 831 I=NTT,NT
O(I)=0.0
831 CONTINUE
CALL QSF(DA,O,GME,NT)

```

PME=1.0/GMF(NT)  
 830 CONTINUE  
 C KILE=9999 MEANS 'CRACK' TAKEN OFF  
 DO 31 KIL=1, NBN1  
 AO=AU-FLOAT(KIL-1)\*DA  
 C  

$$ATH=(DKTH/(Q/ANS)**(1.0/BE)) * 2^(2.0/PI)$$

$$TB=2.0/(2.0-EFD)/CDS/2**((EFD/BE)*ANS**((EFD-BE)/BE))$$

$$TB=TB/(PI/2.0)**((EFD/2.0))$$

$$T3=TB*((ATH**((2.0-EFD)/2.0))-AO**((2.0-EFD)/2.0))$$
 C  

$$EC0=((2.0-EF)/2.0)*CDS**((EF/BE)*ANS**((BE-EF)/BE))$$

$$1*(PI/2.0)**((EF/2.0))$$

$$ECQD=((2.0-EFD)/2.0)*CDS*Q**((EFD/BE)*ANS**((BE-EFD)/BE))$$

$$1*(PI/2.0)**((EFD/2.0))$$
 DO 8 I=1, NPT  
 T=FLOAT(I-1)\*DT  
 IF(TR.GT.0.0) GO TO 43  
 C IN CASE OF ATH.LT.AO  
 A(I)=AO\*\*((2.0-EF)/2.0)  
 A(I)=A(I)+EC0\*T  
 IF(A(I).LT.0.00001) GO TO 45  
 A(I)=A(I)\*\*(2.0/(2.0-EF))  
 GO TO 48  
 43 CONTINUE  
 IF(T.GT.TB) GO TO 49  
 C IN CASE OF ATH.GT.AO  
 A(I)=AO\*\*((2.0-EFD)/2.0)  
 A(I)=A(I)+ECQD\*T  
 IF(A(I).LT.0.00001) GO TO 45  
 A(I)=A(I)\*\*(2.0/(2.0-EFD))  
 C  
 GO TO 48  
 C  
 49 A(I)=ATH\*\*((2.0-EF)/2.0)  
 A(I)=A(I)+ECQD\*(T-TB)  
 IF(A(I).LT.0.00001) GO TO 45  
 A(I)=A(I)\*\*(2.0/(2.0-EF))  
 GO TO 48  
 45 A(I)=10000.0  
 C  
 48 IF(FSF.EQ.0.0) AS=1000.0  
 IF(ABS(A(I)).GT.AS) GO TO 15  
 IF(KILE.NE.9999) GO TO 415  
 8 CONTINUE  
 GO TO 46  
 .15 KK=I  
 DO 60 I=KK, NPT  
 50 A(I)=AS  
 46 CONTINUE  
 GO TO 416  
 415 DO 417 I=2, NPT  
 417 A(I)=A(I)  
 416 CONTINUE  
 C ## A(I) CAL. END ##  
 IF(KILE.NE.9999) GO TO 430  
 ABC=AO\*1.2

```

430 IF(A(NPT).LT.ABC) KILE=KIL+1
CONTINUE
IF(ATH.GT.AC) GO TO 353
TC=2.0/(2.0-EF)**(AC**((2.0-EF)/2.0)-ATH**((2.0-EF)/2.0))
TC=TC/C/Q**((EF/BE)/ANS**((BE-EF)/BE)/(PI/2.0)**(EF/2.0))
TC=TC+TB
GO TO 364
353 TC=2.0/(2.0-EFD)**(AC**((2.0-EFD)/2.0)-A0**((2.0-EFD)/2.0))
TC=TC/CD/0.2**((EFD/BE)/ANS**((BE-EFD)/BE)/(PI/2.0)**(EFD/2.0))
354 CONTINUE
800 CONTINUE
801 CONTINUE
C RESIDUAL STRENGTH RATE ( FSF=1.0(FAIL SAFE) =0.0(ND FAIL SAFE) )
DO 431 I=1,NPT
IF(FSF.EQ.1.0) GO TO 189
IF(A(I).LE.AC) GO TO 183
R(I)=FLOAT(KC)*SQR(2.0/PI/A(I))/R0
GO TO 18
188 R(I)=1.0
GO TO 18
139 SW=ABS((A(I)-A0)/(AS-A0))
R(I)=1.0-(1.0-ZETA)*SQR(SW)
13 IF(KILE.NE.9999) GO TO 418
431 CONTINUE
GO TO 419
418 DO 420 I=2,NPT
420 R(I)=R(I)
419 CONTINUE
C $ $$ CAL. OF H $ $$ 
DO 115 N=1,NPT
HWA=0.0
GMN=R(N)
DO 116 I=1,3
IF(CMP(I).EQ.0.0) SGC(I)=SSS(I)
VX(I)=SGC(I)/X0
ANETA(I)=GMN*AMU0/SGC(I)-X0/SGC(I)
RR(I)=V0*GMN*AMU0/SGC(I)
IF(CMP(I).NE.1.0) GO TO 21
ARG0=ANETA(I)/SQR(2.0)/RR(I)
ARG1=-ANETA(I)+RR(I)**2/2.0
ARG2=(ANETA(I)-RR(I)**2)/SQR(2.0)/RR(I)
IF(CMP(I).EQ.1.0) CAL_HSV(H(N),ARG0,ARG1,ARG2,ARG3,ARG4,
1 ARG5,ARG6,ARG7,ARG8,PP(I),AN(I))
GO TO 411
21 CONTINUE
ARG3=ANETA(I)/RR(I)/SQR(2.0)
ARG4=1.0/SQR(1.0+RR(I)**2)
ARG5=-0.5*(1.0/VX(I)**2+1.0/V0**2)
ARG6=0.5*(PR(I)/VX(I)+1.0/V0)**2/(1.0+RR(I)**2)
ARG7=ANETA(I)/SQR(2.0)/RR(I)/SQR(1.0+RR(I)**2)
ARG8=1.0/SQR(2.0)/SQR(RR(I)**2+1.0)
1*((EL-1.0)/RR(I)/VX(I)+EL/RR(I)/VX(I)-1.0/V0)
IF(CMP(I).EQ.0.0) CAL_HSV(H(N),ARG0,ARG1,ARG2,ARG3,ARG4,
1 ARG5,ARG6,ARG7,ARG8,PP(I),AN(I),JPC(I))
411 CONTINUE
HWA=HWA+H(N)
116 CONTINUE
H(N)=HWA

```

```

IF(H(N).GT.1.0) H(N)=1.0
115 CONTINUE
GO TO 422
421 DO 423 I=2,NPT
423 H(I)=H(1)
422 CONTINUE
C ## CAL. OF H END ##
CALL QSF(DT,H,TH,NPT)
KIP=NBN1-(KIL-1)
DO 25 I=1,NN1
GA(KIP,I)=A(IT0(I))
GTH(KIP,I)=TH(IT0(I))
25 CONTINUE
31 CONTINUE
C *SUBROUTINE CIN CURSORY+RIGOROUS INSPECTIONS
C IF(CSRY.EQ.1.0) CALL SIN(GA,GTH,0,CA1,NC,NR,NN,IT0)
C IF(CSRY.EQ.1.0) GO TO 81
C *SUBROUTINE HIN RIGOROUS INSPECTION
CALL HIN(GA,GTH,0,NN,IT0)
GO TO 81
322 STOP
END
SUBROUTINE HCOM(H,AR0,AR1,AR2,AR3,AR4,AR5,
1 AR6,AR7,AR8,P,AN)
C CAL. FOR COMPOSITE GAUSSIAN
H=0.5*AN*P*((1.0-ERF(AR0))+EXP(AR1)*(1.0+ERF(AR2)))
RETURN
FND
SUBROUTINE HSIN(H,AR0,AR1,AR2,AR3,AR4,AR5,
1 AR6,AR7,AR8,P,AN,UPC)
C CAL. FOR SINGLE GAUSSIAN
IF(UPC.EQ.1.0) GO TO 10
C COMPLETE SINGLE GAUSSIAN
H=0.5*AN*P*((1.0-ERF(AR3))+AR4
1*EXP(AR5+AR6)*(ERF(AR7)+ERF(AR8)))
GO TO 25
C UPPER CUT SINGLE GAUSSIAN
10 H=0.5*AN*P*((1.0-ERF(AR3))+AR4
1*EXP(AR5+AR6)*(ERF(AR7)+ERF(AR8)))
25 RETURN
FND
FUNCTION ERF(X)
IF(ABS(X).GT.10.0) GO TO 3
X=X*1.414214
T=1.0/(1.0+.2316419*ABS(X))
D=0.398942*EXP(-X*X/2.0)
ERF=2.*((0.5-D*T*((((1.33274*T-1.821256)*T+1.781478)*T
1-0.356563)*T+0.319381))
IF(X) 1,2,2
1 ERF=-ERF
GO TO 2
3 ERF=1.0
IF(X.LT.0.0) ERF=-ERF
2 RETURN
END
SUBROUTINE HIN(A,H,G,NN,IT0)
DIMENSION A(126,15),H(126,15),G(126), IT0(125),PX(126),PA(15)

```

```

DIMENSION TPA(15)
COMMON A1,A2,RM,U,NT,NPT,DA,NF,PM
C NP=1 MEANS SKIP TO WRITE
NP=1
N=NN+1
WRITE(6,600) NN
600 FORMAT(1H,'NN=' ,I3)
IF(NN.NE.0) GO TO 987
C NO INSPECTION CASE ***
C NO INSPECTION CASE ***
C NO INSPECTION CASE ***
N=6
DO 900 I=1,N
DO 901 J=1,NT
901 PX(J)=OMEXP(-H(J,I))*G(J)
CALL QSF(DA,PX,PX,NT)
PA(I)=PX(NT)
PA(I)=PA(I)*PM
IF(PA(I).GT.0.0001) GO TO 324
TPA(I)=FLOAT(NF)*PA(I)-FLOAT(NF)*FLOAT(NF-1)*PA(I)**2/2.0
GO TO 325
324 IF(PA(I).GT.0.9) GO TO 326
TPA(I)=1.0-(1.0-PA(I))**NF
GO TO 325
325 TPA(I)=1.0
325 CONTINUE
900 CONTINUE
WRITE(6,620)
620 FORMAT(1H,'RESULT OF NP INSPEC. CASE 1')
DO 902 I=1,N
IT=((NPT-1)/N)+I+1
WRITE(6,621) IT,PA(I),TPA(I)
621 FORMAT(1H,' IT=' ,I5,3X,' PA=' ,E15.7,3X,' TPA=' ,E15.7)
902 CONTINUE
GO TO 17
C
987 CONTINUE
C INSPECTION CASE ***
C INSPECTION CASE ***
C INSPECTION CASE ***
IF(NP.EQ.1) GO TO 738
WRITE(6,699) (G(I),I=1,NT)
699 FORMAT(1H,5E15.7)
DO 10 I=1,NT
WRITE(6,666) (-A(I,M),M=1,6)
666 FORMAT(1H,6E15.7)
10 CONTINUE
DO 20 I=1,NT
WRITE(6,666) (-A(I,M),M=1,6)
20 CONTINUE
738 CONTINUE
C CALCULATE THE FIRST PROB.
DO 240 I=1,NT
240 PX(I)=OMFX3(-H(I,1))*G(I)
CALL QSF(DA,PX,PX,NT)
PA(I)=PX(NT)
J=1
IF(NP.EQ.1) GO TO 888
280 WRITE(6,170) J,PA(I)
170 FORMAT('PA',I4,' = ',E14.7)

```

```

888 CONTINUE
C*-----CALCULATE THE 2 - N PROB.
C      CALCULATE THE 2 - N PROB.
      DD 100 J=2,N
      DD 140 I=1,NT
C ** FIRST TERM
      RH1=H(I,1)
      RA1=A(I,1)
      RF1=FF(RA1)
      TER1=OMEXP(-RH1)
      AR1=RF1*PA(J-1)
      TER2=(1.-TER1)*AR1
      TERM1=TER1+TER2
      IF (NP .EQ. 1) GO TO 260
      WRITE(6,270) RH1,RA1,AR1,TER1,TER2,TERM1
270 FORMAT(6X,E12.5,2F8.5,2E12.5,E14.7)
C ** THIRD TERM
250 FA=0.
      JM1=J-1
      DO 250 KK=1,JM1
      M=J-KK
      RA3=A(I,M)
      RF3=1.-FF(RA3)
      RH3=H(I,M)
      RH4=H(I,M+1)
      TER3=RH4-RH3
      TER4=RF3*((1.-OMEXP(-RH3))*OMEXP(-TER3)+FA)
      IF (NP .EQ. 1) GO TO 250
      WRITE(6,350) RH3,RH4,RA3,RF3,TER3,TER4
350 FORMAT(6X,2E12.5,2F8.5,E12.5,E14.7)
250 FA=TER4
      TERM3=FA
C ** SECOND TERM
      TERM2=0.
      IF(J.LE.2)GO TO 200
      J2=J-2
      FA=1.0
      DO 550 K=1,J2
      RH2=H(I,K+1)
      RA2=A(I,K+1)
      RA=A(I,K)
      FA=FA*(1.-FF(RA))
      RF2=FF(RA2)
      ARG2=1.-OMEXP(-RH2)
      TERM=FA*RF2*ARG2* PA(J-K-1)
      TERM2=TERM2+TERM
      IF (NP .EQ. 1) GO TO 550
      WRITE(6,160) RH2,RA2,RA,FA,RF2,ARG2,TERM
160 FORMAT(2X,E12.5,4F8.5,E12.5,E14.7)
550 CONTINUE
C SUM OF THE ALL TERMS
200 TERM4=TERM1+TERM2+TERM3
      PX(I)=TERM4*G(I)
      IF (NP .EQ. 1) GO TO 140
      WRITE(6,180) I,TERM4,G(I),PX(I)
180 FORMAT(14,'**',3E14.7)
140 CONTINUE
      CALL QSF(DA,PX,PX,NT)
      PA(J)=PX(NT)
      IF(NP.EQ.1) GO TO 100

```

```

100 WRITE(6,170) J,PA(J)
100 CONTINUE
DO 111 J=1,N
PA(J)=PA(J)*PME
111 CONTINUE
DO 887 J=1,N
IF(PA(J).GT.0.0001) GO TO 334
TPA(J)=FLOAT(NF)/PA(J)-FLDAT(NF)*FLOAT(NF-1)*PA(J)**2/2.0
GO TO 335
334 IF(PA(J).GT.0.9) GO TO 336
TPA(J)=1.0-(1.0-PA(J))*NF
GO TO 335
335 TPA(J)=1.0
335 CONTINUE
887 CONTINUE
I=NT
WRITE(6,510)
510 FORMAT(4X,1H T,12X,'A',12X,'H',14X,'PA',11X,'TPA')
WRITE(6,520) (ITD(J),A(I,J),H(I,J),PA(J),TPA(J),J=1,N)
520 FORMAT(15,4E14.7)
17 CONTINUE
RETURN
END
SUBROUTINE CIN(A,H,G,CA1,NC,NR,NN,ITD)
DIMENSION A(126,15),H(126,15),G(126),ITD(15),2X(126),PA(15)
COMMON A1,A2,RM,U,NT,VPT,DA,NF,PME
C NP=1 MEANS SKIP TO WRITE
N
WRITE(6,600) NN
600 FORMAT(1H 'NN=',I3)
IF(NP.EQ.1) GO TO 738
WRITE(6,699)-(G(I),I=1,NT)
699 FORMAT(1H ,5E15.7)
DO 10 I=1,NT
WRITE(6,665) (A(I,M),M=1,6)
665 FORMAT(1H ,6E15.7)
10 CONTINUE
DO 20 I=1,NT
WRITE(6,666) (+I,M),M=1,6
20 CONTINUE
738 CONTINUE
C CALCULATE THE FIRST PROB.
DO 240 I=1,NT
240 PX(I)=QEXP(-H(I,1))*G(I)
CALL QSF(DA,PX,PX,NT)
PA(1)=PX(NT)
J=1
IF(NP.EQ.1) GO TO 888
230 WRITE(6,170) J,PA(1)
170 FORMAT( /'PA',I4,' = ',E14.7)
888 CONTINUE
C CALCULATE THE 2 - N PROB.
DO 100 J=2,N
DO 140 I=1,NT
140 CONTINUE
C ** FIRST TERM
RHI=H(I,1)
RA1=A(I,1)
NC1=NC+1

```

```

JM1=J-1
JD=JM1/NC1
JOO=JO*NC1
IF(JOO.EQ.JM1) RF1=FF(RA1)
IF(JOO.NE.JM1) RF1=FC(RA1)
TER1=OMEXP(-RH1)
AR1=RF1*PA(J-1)
TER2=(1.-TER1)*AR1
TERM1=TER1+TER2
IF (NP.EQ. 1) GO TO 260
WRTTE(6,270) RH1,RA1,AR1,TER1,TER2,TERM1
270 FORMAT(6X,E12.5,2F8.5,2E12.5,E14.7)
C ** THIRD TERM
250 FA=0.
JM1=J-1
DO 250 KK=1,JM1
M=J-KK
RA3=A(I,M)
NC1=NC+1
JMM=J-M
JY=JMM/NC1
JYY=JY*NC1
IF(JYY.EQ.JMM) RF3=1.-FF(RA3)
IF(JYY.NE.JMM) RF3=1.-FC(RA3)
RH3=H(I,M)
RH4=H(I,M+1)
TER3=RH4-RH3
TER4=RF3*((1.-OMEXP(-RH3))*OMEXP(-TER3)+FA)
IF (NP.EQ.1) GO TO 250
WRITE(6,350) RH3,RH4,RA3,RF3,TER3,TER4
350 FORMAT(6X,2E12.5,2F8.5,E12.5,E14.7)
250 FA=TER4
TERM3=FA
C ** SECOND TERM
TERM2=0.
IF(J.LE.2)GO TO 200
J2=J-2
FA=1.0
DO 550 K=1,J2
RH2=H(I,K+1)
RA2=A(I,K+1)
RA=A(I,K)
NC1=NC+1
JMK=J-K
JT=JMK/NC1
JTT=JT*NC1
IF(JMK.EQ.JTT) FA=FA*(1.-FF(RA))
IF(JMK.NE.JTT) FA=FA*(1.-FC(RA))
JMK1=J-(K+1)
JU=JMK1/NC1
JUU=JU*NC1
IF(JUU.EQ.JMK1) RF2=FF(RA2)
IF(JUU.NE.JMK1) RF2=FC(RA2)
ARG2=1.-OMEXP(-RH2)
TERM=FA*RF2*ARG2* PA(J-K-1)
TERM2=TERM2+TERM
IF (NP.EQ.1) GO TO 550
WRITE(6,160) RH2,RA2,RA,FA,RF2,ARG2,TERM
160 FORMAT(2X,E12.5,4F8.5,E12.5,E14.7)
550 CONTINUE

```

```

C SUM OF THE ALL TERMS
200 TERM4=TERM1+TERM2+TERM3
      PX(I)=TERM4*G(I)
      IF (NP.EQ.1) GO TO 140
      WRITE(6,180) I,TERM4,G(I),PX(I)
130 FORMAT(14,171,3E14.7)
140 CONTINUE
      CALL QSF(DA,PX,PX,NT)
      PA(J)=PX(NT)
      IF (NP.EQ.1) GO TO 100
      WRITE(6,170) J,PA(J)
100 CONTINUE
      D0 111 J=1,N
      PA(J)=PA(J)*PME
111 CONTINUE
      D0 887 J=1,N
      IF(PA(J).GT.0.0001) D0 TO 334
      TPA(J)=FLOAT(NF)*PA(J)-FLOAT(NF)*FLOAT(NF-1)*PA(J)**2/2.0
      GO TO 335
334 IF(PA(J).GT.0.9) GO TO 336
      TPA(J)=1.0-(1.0-PA(J))**NF
      GO TO 335
335 TPA(J)=1.0
335 CONTINUE
837 CONTINUE
      NR1=NR+1
      D0 26 I=1,NR1
      J=(NC+1)*I
      WRITE(6,670) I,PA(J),TPA(J),ITO(J)
670 FORMAT(1H,' ',I2,I2,I2,' =',E15.7,7X,E15.7,10X,I5)
26 CONTINUE
17 CONTINUE
      RETURN
      END
      FUNCTION FF(X)
      COMMON A1,A2,RM,J
      IF(X.LE.A1) GO TO 10
      IF(X.GE.A2) GO TO 20
      FF=U*((X-A1)/(A2-A1))**RM
      RETURN
10 FF=0.0
      RETURN
20 FF=1.0
      RETURN
      END
      SUBROUTINE DENST(G, NN,AU,AL,DA)
      DIMENS ION G(1)
      COMMON/QWE/ ALPHA,BETA,EFD,COS,Q,ANS,BE
      C1=COS
      S=EFD
      FND=ANS
      ARFA=ALP HA
      B=BE
      PI=3.14159
      S2=S/2.
      QMS2=1.-S2
      ASP=AU**QMS2
      H1=C1*(PI/2.)**S2*Q**((S/3.)*FND*(1.-S/B))
      H2=QMS2**H1
      DA=(AU-AL)/FLOAT(NN-1)

```

```

DO 10 K=1,NN
AK=AU-DA*FLOAT(K-1)
ARK=AK/AU
DELT=1.-ARK
TK=(-ASR-ARK+OMS2)/H2
L=NN-(K-1)
G(L)=ARFA*AK**(-S2)*(TK/RETAL)**(ARFA-1)*
1 EXP(-(TK/BETA)**ARFA)/(H1*BETA)
IF(G(L).EQ.0.0) GO TO 10
IF(G(L).LT.1.0E-50) GO TO 20
10 CONTINUE
GO TO 40
20 CONTINUE
DO 30 I=1,L
30 G(I)=0.0
40 RETURN
END
FUNCTION OMEXP(X)
R=-50.0
C=1.0E-20
IF(ABS(X).LT.C) GO TO 5
IF(ABS(X).LT.0.01) GO TO 10
IF(X.LT.B) GO TO 30
OMEXP=1.-EXP(X)
RETURN
5 OMEXP=-0.999999*X
RETURN
10 OMEXP=-0.166666*X*X-X-0.499999*X*X-0.999999*X
RETURN
30 OMEXP=1.
RETURN
END
SUBROUTINE QSF(H,Y,Z,NDIM)
C
C DIMENSION Y(1),Z(1)
C
HT=.3333333*H
IF(NDIM-5)7,8,1
C
C NDIM IS GREATER THAN 5. PREPARATIONS OF INTEGRATION LOOP
1 SUM1=Y(2)+Y(2)
SUM1=SUM1+SUM1
SUM1=HT*(Y(1)+SUM1+Y(3))
AUX1=Y(4)+Y(4)
AUX1=AUX1+AUX1
AUX1=SUM1+HT*(Y(3)+AUX1+Y(5))
AUX2=HT*(Y(1)+3.875*(Y(2)+Y(5))+2.625*(Y(3)+Y(4))+Y(6))
SUM2=Y(5)+Y(5)
SUM2=SUM2+SUM2
SUM2=AUX2-HT*(Y(4)+SUM2+Y(6))
Z(1)=0.
AUX=Y(3)+Y(3)
AUX=AUX+AUX
Z(2)=SUM2-HT*(Y(2)+AUX+Y(4))
Z(3)=SUM1
Z(4)=SUM2
IF(NDIM-6)5,5,2
C
C INTEGRATION LOOP

```

```

2 DO 4 I=7,NDIM,2
SUM1=AUX1
SUM2=AUX2
AUX1=Y(I-1)+Y(I-1)
AUX1=AUX1+AUX1
AUX1=SUM1+HT*(Y(I-2)+AUX1+Y(I))
Z(I-2)=SUM1
IF( I-NDIM )3,6,6
3 AUX2=Y(I)+Y(I)
AUX2=AUX2+AUX2
AJX2=SUM2+HT*(Y(I-1)+AUX2+Y(I+1))
4 Z(I-1)=SUM2
5 Z(NDIM-1)=AUX1
Z(NDIM)=AUX2
RETURN
6 Z(NDIM-1)=SUM2
Z(NDIM)=AUX1
RETURN
C END OF INTEGRATION LOOP
C
7 IF(NDIM-3)12,11,8
C
8 NDIM IS EQUAL TO 4 OR 5
SUM2=1.125*HT*(Y(1)+Y(2)+Y(2)+Y(3)+Y(3)+Y(3)+Y(4))
SUM1=Y(2)+Y(2)
SUM1=SUM1+SUM1
SUM1=HT*(Y(1)+SUM1+Y(3))
Z(1)=0.
AUX1=Y(3)+Y(3)
AUX1=AUX1+AUX1
Z(2)=SUM2-HT*(Y(2)+AJX1+Y(4))
IF(NDIM-5)10,9,9
9 AUX1=Y(4)+Y(4)
AUX1=AUX1+AUX1
Z(5)=SUM1+HT*(Y(3)+AUX1+Y(5))
10 Z(3)=SUM1
Z(4)=SUM2
RETJRN
C
11 NDIM IS EQUAL TO 3
SUM1=HT*(1.25*Y(1)+Y(2)+Y(2)-.25*Y(3))
SUM2=Y(2)+Y(2)
SUM2=SUM2+SUM2
Z(3)=HT*(Y(1)+SUM2+Y(3))
Z(1)=0.
Z(2)=SUM1
12 RETURN
END
FUNCTION FC(A)
COMMON/POI/ CA1,NC,NR
IF(A.LT.CA1) FC=0.
IF(A.GE.CA1) FC=1.
RETURN
END
//GO.SYSIN DD *
123.0
-123.0
/

```